The DDC112's Test Mode

By Jim Todsen

This application bulletin covers the DDC112's test mode. It elaborates on the explanation given in the data sheet and is written with the purpose of helping you use the test mode to its fullest capability. It does assume a basic understanding of the DDC112's operation. For a good introduction to the DDC112, see the DDC112's data sheet.

The organization of this application bulletin is as follows: First, an overview presents the basic operation of the test mode. Next are explanations of single packet and multiple packet test signals. Noise and linearity performance of the test mode are then covered followed by some special considerations for using the test mode. Finally, a program for investigating test mode performance is discussed with the listing for the program given afterwards.

OVERVIEW

During normal operation, a sensor connected to each DDC112 input supplies signal current which is measured by DDC112 and converted to a 20-bit digital word. To help with debug during system development and to provide a good system-level diagnostic check, the DDC112 has a test mode which is enabled by the TEST pin. While in test mode, the inputs are disconnected and a test signal is measured instead. Figure 1 shows a simplified block diagram of the front end of the DDC112 including test mode circuitry.

You enter test mode by holding TEST HIGH while CONV toggles. Likewise, you exit test mode by holding TEST LOW while CONV toggles. The integration timing control for test mode is identical to that of normal operation: CONV still sets the side (A or B) and length of integration. As in normal operation, there is a continuous and non-continuous mode in test mode determined by the length of T_{INT} (see Application Bulletin AB-131 for more information on the continuous and non-continuous modes).

C_{TEST} in Figure 1 supplies the test signal to the front-end integrators. Switches S_A and S_B, which in normal operation steer the sensor's current to the A or B integrator, are opened and S_{AT}, S_{BT} and S_{VT} are used instead (these switches are only used in test mode). C_{TEST}, previously charged to V_{REF} by S_{VT}, is dumped to the appropriate side by either S_{AT} or S_{BT} depending on CONV. After the dumped charge from C_{TEST} is integrated by C_{INT}, S_{AT} (or S_{BT}) opens and C_{TEST} recharges to V_{REF} via S_{VT}. C_{TEST} is now ready for another charge dump. When the integration period is over, the ADC measures the signal integrated onto C_{INT} (the total test signal dumped by C_{TEST}) just as in normal operation. S_{GND} shorts

the DDC112's inputs to ground during test mode to prevent any current from the sensor building a charge on the DDC's inputs.

C_{TEST} can be dumped once or multiple times onto the integrator during an integration period. The next two sections explain the timing necessary to control the number of dumps. Note that the magnitude of the test signal is not a direct function of the integration time T_{INT}, but rather the number of charge packet dumps. If the number of charge packets dumped remains constant, changing T_{INT} will not affect the test mode data.
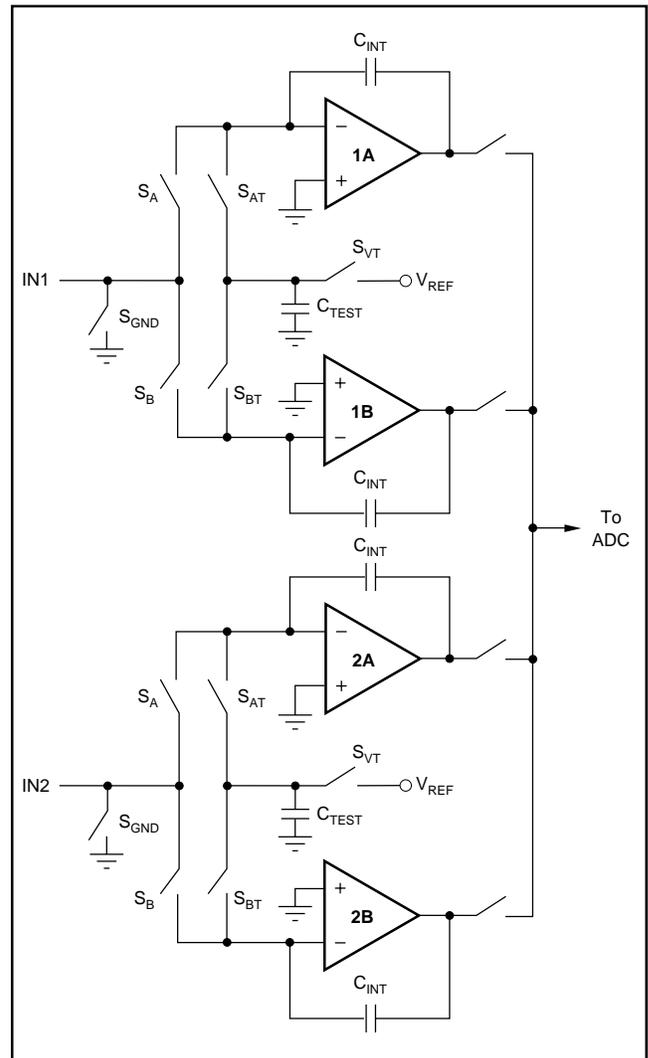

FIGURE 1. Simplified Block Diagram of the DDC112's Front End.

Printed in U.S.A. July, 1998

SBAA025

SINGLE PACKET

When TEST is held HIGH, a single packet of charge from C_{TEST} is dumped onto the integrator at the beginning of every test mode integration. Figure 2 shows the timing diagram and specifications for this case. The Integrator Status trace highlights the fact that the test mode functions the same as normal operation with respect to integration, measurement, auto-zero, reset, etc. The bottom trace of Figure 2 shows the output voltage on the side A integrator.

CONV triggers the sequence that controls S_{AT}, S_{BT} and S_{VT}. A short time after CONV toggles, S_{VT} opens and switch S_{AT} (or S_{BT}) dumps C_{TEST}'s charge onto the appropriate integrator side. After the charge transfers from C_{TEST} to C_{INT}, switch S_{AT} (or S_{BT}) opens and C_{TEST} recharges to V_{REF} using S_{VT}. The test circuitry then waits until the next integration begins before dumping C_{TEST} to the other side. This cycle

continues until TEST is held LOW while CONV toggles. At that point, the test mode is over and normal operation resumes.

The size of each charge packet is $(V_{REF})(C_{TEST})$, approximately 13pC. If, for example, the range is set to 250pC, a single packet test signal equals approximately 5.2% of full scale. The absolute value of the charge packet can vary by 20% or more due to fabrication process variations. As previously mentioned, the readings during single packet test mode are independent of T_{INT} since the test mode supplies a fixed amount of charge ($\approx$13pC) each integration.

The A and B sides of a channel use the same C_{TEST}. Due to the nature of the switching arrangement, there is a small imbalance in the charge injection between sides A and B during test mode. This imbalance results in slightly different effective sizes for the side A and B test packets. Typical mismatch between side A and B charge packets is $\approx$0.2pC.

$$\Delta V = \frac{C_{TEST} V_{REF}}{C_{INT}} \approx \frac{13pC}{C_{INT}}$$

$$\frac{dv}{dt} = \frac{I_{SENSOR}}{C_{INT}}$$

SYMBOL	DESCRIPTION	MIN	TYP	MAX	UNITS
t_1	Setup Time for Test Mode Enable	100			ns
t_2	Setup Time for Test Mode Disable	100			ns
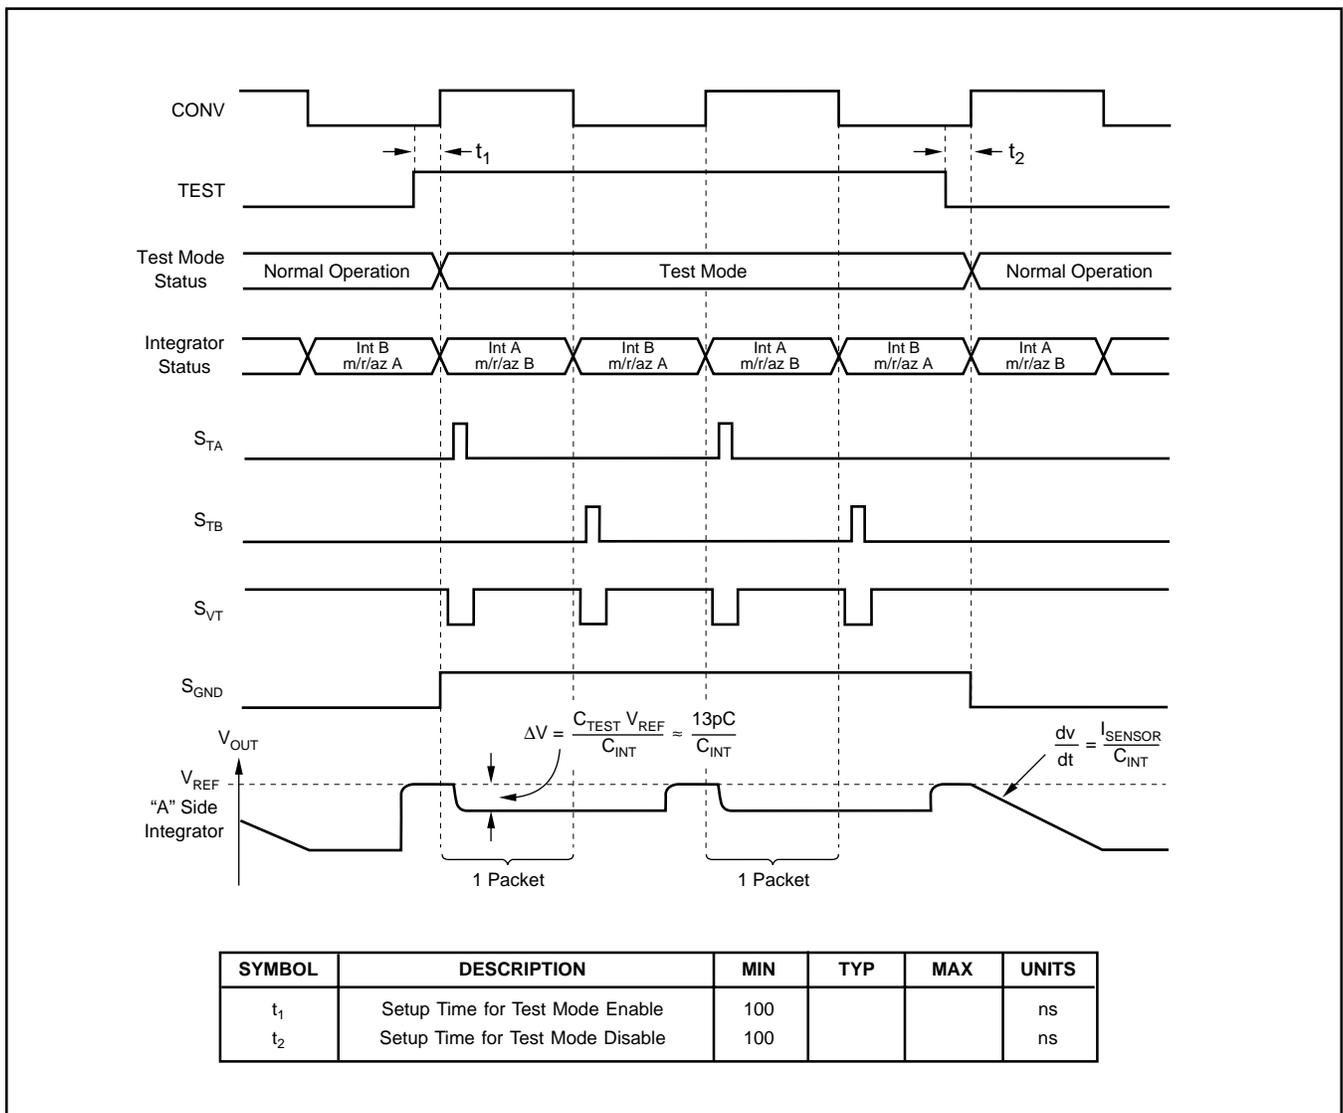
FIGURE 2. Single Packet Test Mode Timing.

MULTIPLE PACKET

As described above, a packet of charge is dumped onto the integrator at the beginning of every integration during the test mode. Additional packets can be dumped creating a larger test signal. Multiple packets are dumped onto the integrator by toggling TEST during the integration as illustrated in Figure 3. The rising edge of TEST during a test mode integration triggers the dumping of an additional packet. Multiple toggles on TEST result in multiple packets being dumped. In order to stay in test mode, TEST must be HIGH when CONV toggles at the end of the integration.

Figure 3 shows the relevant timing specifications for multiple packet dumps. The specifications limit the maximum number of multiple packet dumps for a given T_{INT}. Since the rising edges of TEST must be at least 5.4μs apart, the maximum number of dumps is $T_{INT}/5.4$μs (round down when this number is a non-integer). This limitation is not a concern during the continuous mode. Even for $T_{INT} = 500$μs, over 90 dumps are allowed which corresponds to more than 1200pC of test signal—easily enough to reach full scale on any range. It is only for the short T_{INT}'s of the noncontinous mode where you need to watch the limit.

NOISE

The noise of the test mode signal is very low. In fact, the noise performance in the test mode is usually better than what can be achieved in normal operation, even with very low sensor capacitance. Since the DDC112's inputs are disconnected during test mode, any coupling or interference on them (e.g., 60Hz pickup) will not affect the readings. This feature can be helpful in isolating the source of interference during system evaluation. Table I lists typical noise performance for the different internal ranges while in test mode with a single packet dump. The noise increases slightly for multiple packet dumps, particularly at the lower ranges.

RANGE (Full-Scale Charge)	TYPICAL NOISE (rms)
1 (50pC)	4.7ppm
2 (100pC)	3.6ppm
3 (150pC)	3.2ppm
4 (200pC)	3.1ppm
5 (250pC)	3.0ppm
6 (300pC)	3.0ppm
7 (350pC)	2.9ppm

TABLE I. Typical Noise Performance in Test Mode.

| SYMBOL	DESCRIPTION	MIN	TYP	MAX	UNITS
t_1	Setup Time for Test Mode Enable	100			ns
t_2	Setup Time for Test Mode Disable	100			ns
t_3	Hold Time for Test Mode Enable	100			ns
t_4	From Rising Edge of Test to the Edge of CONV while Test Mode Enabled	5.4			μs
t_5	Rising Edge to Rising Edge of TEST	5.4			μs
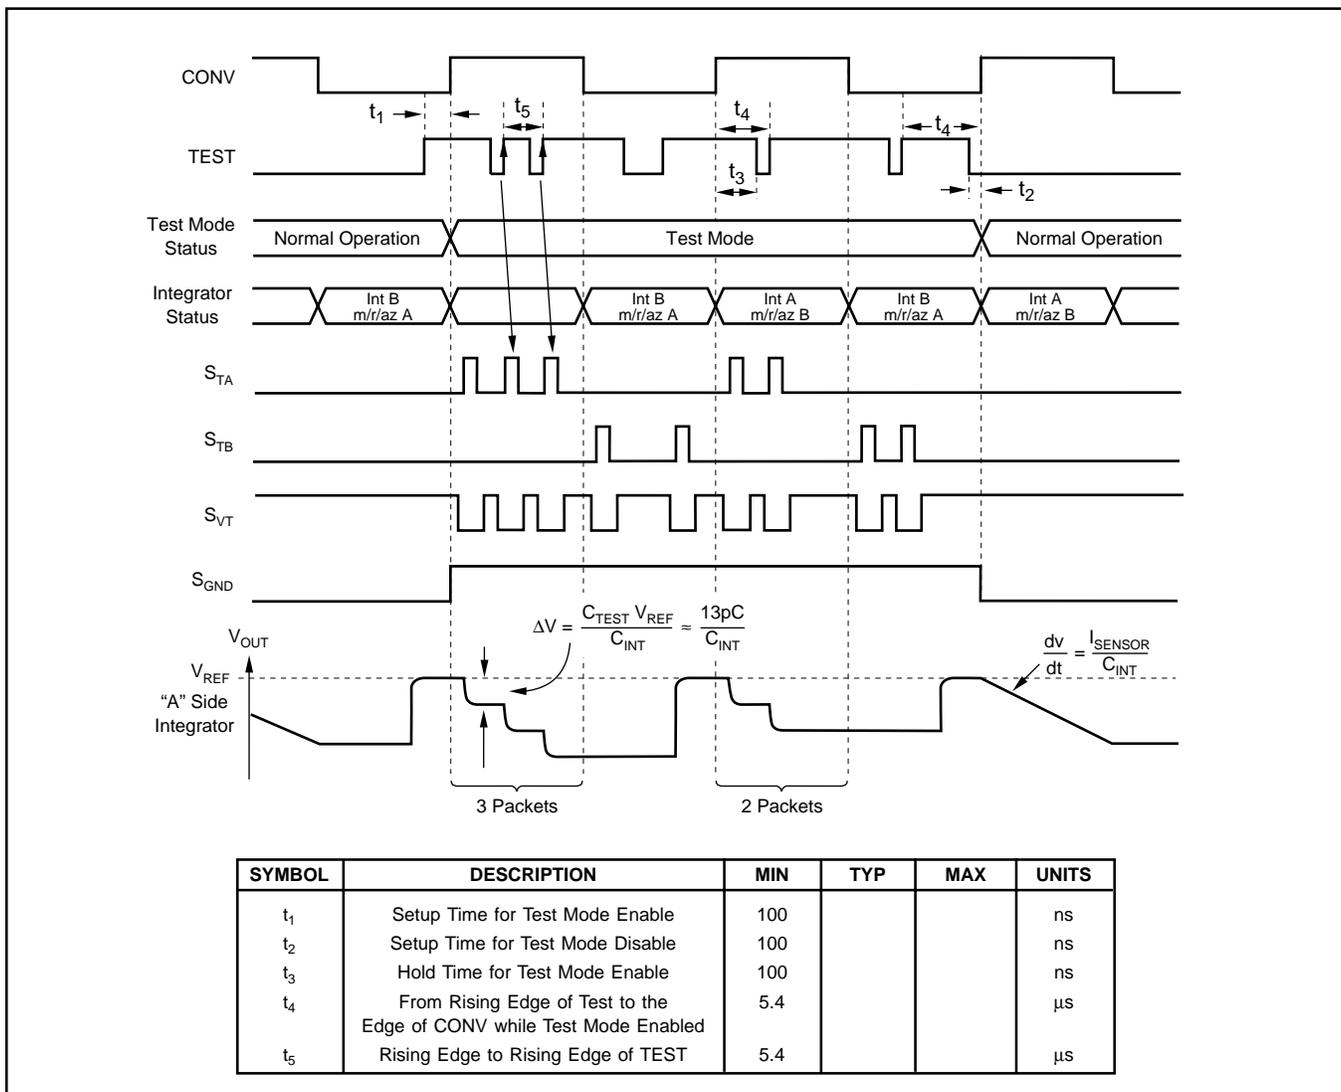
FIGURE 3. Multiple Packet Test Mode Timing.

LINEARITY

As with the noise performance, the linearity of the test signal is very good. Measurements made in the test mode show that the linearity of the test mode is usually limited by the performance of the DDC112 itself. That is, the linearity of the test mode is typically only slightly worse than the linearity measured in normal operation with a linear input signal. Figure 4 shows a comparison of integral non-linearity (INL) for normal operation of the DDC112 with a very linear input signal and for the test mode. INL is defined here as the deviation of the data from a line connected between the data's end points. Notice in Figure 4 how the test mode INL is only slightly worse than that of the DDC112 in normal operation. This indicates that the test mode signal is very linear and the linearity of the test mode is limited by the DDC112's inherent linearity.
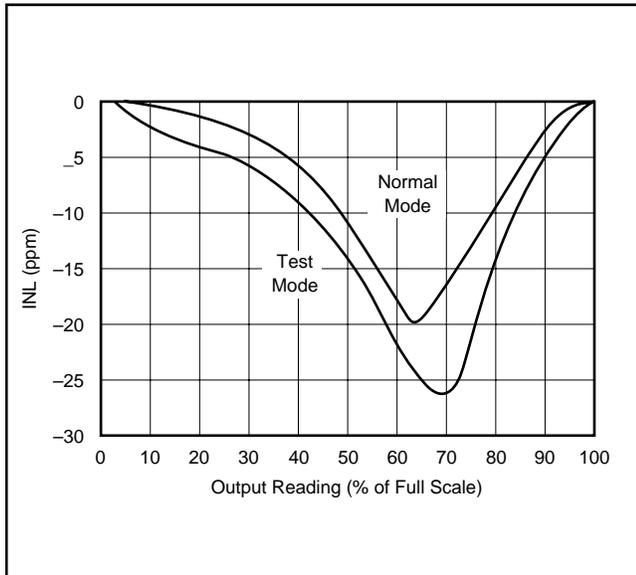
FIGURE 4. Normal Mode and Test Mode INL (end-point line fit).

SPECIAL CONSIDERATIONS

For the very best performance in test mode, T_{INT} might need to be an integer multiple of 3 CLK periods, depending on your PC board layout. For example, if CLK = 10MHz, T_{INT} might need to be a integer multiple of 300ns. If T_{INT} is not an integer multiple of 3 CLK periods, there can be excessive noise in the test mode. The reason for this is explained in Application Bulletin, AB-131. Basically, the internal slow clock (discussed in AB-131) is always left running while in test mode, even when $T_{INT} > 4794$ CLK periods.

To prevent requiring T_{INT} to be an integer multiple of 3 CLK periods, pay close attention to the PC board layout. Place the bypass capacitors for V_{REF} and the power supplies as close to the pins as possible. Use a good analog ground plane with the analog pins on the DDC112 connecting directly to it. See the Evaluation Fixture layout for an example. In this layout, the test mode noise shows no need for T_{INT} to be an integer multiple of 3 CLK periods. That is, the same noise performance is achieved with $T_{INT} = 500\mu s$, $501\mu s$, $502\mu s$, etc.

EXAMPLE PROGRAM

To help investigate the test mode, a Pascal program similar to the one in Application Bulletin, AB-125 is given in Listing 1. This program runs under DOS and controls the Evaluation Fixture hardware. Using the program, you can change the number of data points averaged per reading, full-scale range, T_{INT}, and the number of test mode packets. With these variables set, you can then retrieve a reading. The displayed average for the retrieved reading is normalized to full scale = 1.0 and the rms noise is given in ppm.

A routine to measure the linearity of the test mode signal is also included in the program. The program determines the size of each packet by making an initial measurement with a single packet test signal. It then calculates the number of packets needed to reach full scale. A loop increments the packets up to this number while taking data at each step. Afterwards, an end-point line is connected between the first point and the final point. The program stores the linearity data in a file and reports the maximum difference between the data points and the end-point line as the INL.

Listing 1

```
(*****************************************************************************)
(*                                                                          *)
(*                        BURR-BROWN  CORPORATION                           *)
(*                                                                          *)
(*                      Application  Bulletin  AB-135                       *)
(*                                                                          *)
(*****************************************************************************)
(*                                                                          *)
(*                        DDC112  Test  Mode  Program                       *)
(*                      Written  in  Turbo  Pascal  7.0                     *)
(*                                                                          *)
(*  This  program  is  designed  to  illustrate  use  of  the  DDC112's     *)
(*  test  mode.  This  program  requires  the  DDC112  to  be  connected  to  the  *)
(*  DDC112  Evaluation  Fixture  DEM-DDC112U-C.   See  AB-125  for  more  info  *)
(*  on  the  Evaluation  Fixture.                                           *)
(*                                                                          *)
(*  The  user  can  program  the  #  of  averages/reading,  range,          *)
(*  tint  and  #  of  test  packets  from  the  menu.   A  single  reading  can  be  *)
(*  retrieved  or  a  complete  measurement  of  the  DDC112's  linearity  can  be  *)
(*  taken.   The  results  of  the  linearity  measurement  are  saved  to  a  file  *)
(*                                                                          *)
(*  Created  by  Jim  Todsen  5/20/98                                       *)
(*                                                                          *)
(*****************************************************************************)
(*{$R-,S-}                                                                  *)
{$A+,B-,E+,F+,G-,I+,L-,N+,O+,R+,S+,V-,X+}


program  DDC112TestMode;

uses    Dos,CRT,Strings;


type
  Real4by1 = array[1..4] of real;     {used  to  store  1a,1b,2a,2b  data}
                                      {1—>1a,  2—>2a,  3—>1b,  4—>2b}
var
  Range                     : longint;
  Tint                      : real;
  Nt                        : longint;
  Tpck                      : longint;
  PCPort                    : longint;
  pPrintPort                : ^word;
  readdr,  wraddr,  strbaddr  : word;
  DataCkCode                : word;
  SysCkCode                 : word;
  Ctrl1Code,  Ctrl2Code     : word;
  DXmitDelayCode            : word;
  UserDDCCode               : word;
  Yave,  Yrms               : Real4by1;

{*****************************************************************************}
procedure  badBeep;
{*****************************************************************************}
begin
  sound(100);
  delay(200);
  nosound;
end;


{*****************************************************************************}
procedure  goodBeep;
{*****************************************************************************}
begin
  sound(300);
  delay(50);
  nosound;
end;
```

```pascal
{*****************************************************************************}
procedure xilinxWrite(XilinxAddr, XilinxData : Byte);
{*****************************************************************************}
{Write data to a specified address on the DDC112 Evaluation Fixture}
begin
 PORT[wraddr]:= $7F AND XilinxAddr;
 Delay(2);
 PORT[strbaddr] := 1;
 Delay(1);
 PORT[strbaddr] := 0;
 Delay(1);
 PORT[wraddr]:= $80 OR XilinxData;
 Delay(2);
 PORT[strbaddr] := 1;
 Delay(1);
 PORT[strbaddr] := 0;
 Delay(1);
end;


{*****************************************************************************}
procedure setRange(newRange: word);
{*****************************************************************************}
{Set the DDC112 range}
begin
 writeln(' setting Range = ',newRange);
 Ctrl1Code := Ctrl1Code AND $78;
 Ctrl1Code := Ctrl1Code OR newRange;
 xilinxWrite(6,Ctrl1Code);
 delay(1000);   {wait for settling after change}
end;


{*****************************************************************************}
procedure setTint(var newTint: real) ;
{*****************************************************************************}
{Set the DDC112 Integration Time}
var
 IntCountCode: longint;
begin
 if newTint > 1500000 then newTint:= 1500000;
 IntCountCode  := round(newTint*10)-1;                    {10 MHz CLK}
 writeln(' setting Tint = ',newTint:7:1);
 xilinxWrite(7,(Ctrl2Code AND $7E));                      {hold conv}
 Delay(1000);                           {wait to insure CONV is stopped}
 xilinxWrite(5,(IntCountCode AND $7F));
 xilinxWrite(4,((IntCountCode SHR 7)  AND $7F));
 xilinxWrite(3,((IntCountCode SHR 14) AND $7F));
 xilinxWrite(2,((IntCountCode SHR 21) AND $07));
 xilinxWrite(7,(Ctrl2Code OR $1));                        {release conv}
end;


{*****************************************************************************}
procedure setTstPckts(NumPckt: longint);
{*****************************************************************************}
{Set the # of Test Packets dumped to the DDC112 each integration}
begin
 if NumPckt > 0 then
 begin
  Ctrl1Code := Ctrl1Code OR $8;                {Test ON}
  xilinxWrite(6,Ctrl1Code);
  if NumPckt = 1 then xilinxWrite(11,127)       {all 1's = 1 packet}
  else  xilinxWrite(11,(NumPckt-2));
 end
 else
 begin
  Ctrl1Code:= Ctrl1Code AND $F7;                {Test OFF}
  xilinxWrite(6, (Ctrl1Code));
 end;
 Delay(1000) ;{settling time after change}
end;
```

```
{*****************************************************************************}
procedure  setPCport(PCport:  word);
{*****************************************************************************}
{Set the address of the PC's parallel port used for the Evaluation Fixture}
begin
 if PCPort = 1 then pPrintPort := Ptr($40,$08)
 else pPrintPort := Ptr($40,$0A);
 wraddr:= pPrintPort^;
 readdr:= wraddr + 1;
 strbaddr:= wraddr + 2;
 PORT[strbaddr]:= 0;        p{init Strobe at 0 (really, 1 out)}
end;


{*****************************************************************************}
procedure  xilinxRefresh;
{*****************************************************************************}
{Refresh the Xilinx FPGAs on the Evaluation Fixture}
begin
 PORT[strbaddr] := 0;      {init port strobe high}
 Delay(1);
 xilinxWrite(0,  DataCkCode);
 xilinxWrite(1,  SysCkCode);
 xilinxWrite(6,  Ctrl1Code);
 xilinxWrite(7,  Ctrl2Code);
 xilinxWrite(8, ((DXmitDelayCode AND $180) SHR 7));
 xilinxWrite(9, ((DXmitDelayCode AND $7F)));
 xilinxWrite(10, (UserDDCCode SHL 1));
 setRange(Range);
 setTint(Tint);
 setTstPckts(TPck);
 goodBeep;
end;


{*****************************************************************************}
procedure getInt(descrip: string; Min, Max: longint;
                 var Value: longint; var Err: boolean);
{*****************************************************************************}
{Get an INTEGER value from the user}
var
 userinput                 : string[25];
 check                     : integer;
 temp                      : longint;

begin
 Err:= true;
 ClrScr;
 writeln;
 writeln(' The current ',descrip,' is: ',Value);
 writeln;
 writeln('  Enter the new ',descrip,':');
 readln(userinput);
 if userinput = 'x' then exit;
 if userinput = 'X' then exit;
 if userinput = '' then exit;
 val(userinput,temp,check);
 if check <> 0 then
 begin
  badBeep;
  writeln(' *** Invalid ',descrip);
  writeln;
  delay(1000);
  exit;
 end
 else
 begin
  if (temp < min) or (temp > max) then
  begin
   badBeep;
   writeln;
   writeln(' *** Invalid ',descrip);
   writeln;
   delay(500);
   exit;
  end
  else
  begin
   Value := temp;
   Err := false;
  end;
 end;
end;
```

```pascal
{***************************************************************************}
procedure  getReal(descrip: string;  Min, Max: longint;
                   var Value: real; var Err: boolean);
{***************************************************************************}
{Get  a  REAL  value  from  the  user}
var
 userinput   : string[25];
 check       : integer;
 temp        : real;

begin
 Err := true;
 ClrScr;
 writeln;
 writeln(' The  current  ',descrip,' is: ',Value:9:3);
 writeln;
 writeln('   Enter  the  new  ',descrip,':');
 readln(userinput);
 if  userinput = 'x'  then  exit;
 if  userinput = 'X'  then  exit;
 if  userinput = ''    then  exit;
 val(userinput,temp,check);
 if  check <> 0 then
 begin
  badBeep;
  writeln('  ***  Invalid  ',descrip);
  writeln;
  delay(500);
  exit;
 end
 else
 begin
  if  (temp < min)  or  (temp > max)  then
  begin
   badBeep;
   writeln;
   writeln('  ***  Invalid  ',descrip);
   writeln;
   delay(1000);
   exit;
  end
  else
  begin
   Value := temp;
   Err := false;
  end;
 end;
end;


{***************************************************************************}
procedure  readData(var  DRdError: Boolean);
{***************************************************************************}
{Readback "Nt" points from Evaluation Fixture; find Yave, Yrms, return status}
Var
 FNum, N                          : longint;   { final  number }
 BusyBit3,  Loop                  : integer;   { data  ready  bit }
 Nib,  D,  SideRd                 : byte;
 PortDataRd                       : byte;
 Ysum,  Ysumsq                    : array[1..4] of Extended;
 temp                             : extended;
 iRd, TRd, K, Count, DataTime, I, J : word;
 FScale,DelTime                   : real;
 FirstTime                        : boolean;
 timereq,  SampleTime             : real;
 numTints                         : word;

begin
 write(' filling  Demo  Board  memory...   ');
 FirstTime := true;      {flag to check for side A or B on first data point}

 if  Tint < 479.4 then   {ncont mode}
 begin
  timereq := 1501*6*1/10 - Tint; {1501=min # of slowclks to finish ncont meas}
  numTints := trunc(timereq / Tint)+1;                     {# of tints skipped}
  if  ((numTints MOD 2) <> 0) then numTints := numTints+1; {numTints must be even}
  SampleTime := Tint*(2+numTints);
 end    {cont}
 else  SampleTime := Tint*2;
```

```
I := 0;
while I < round(Nt*1.4 + 50) do   {extra margin for safety}
begin
 delay(round(sampleTime/1e3));
 if KeyPressed AND (ReadKey = Chr(27)) then
 begin
  goodBeep;
  I := round(Nt*1.4 + 50);
 end;
 I := I + 1;
end;

xilinxWrite(6, Ctrl1Code AND $5F);           {enable readback}

{wait for PC Interface Board Data Valid}
K := 0;
DRdError := false;
BusyBit3 := (PORT[readdr] AND $08) SHR 3;   {initialize bit 3}
While (BusyBit3 <> 1) AND (K <= 20000) do
begin
 BusyBit3 := (PORT[readdr] AND $08) SHR 3;
 inc(K);
 if (K mod 40) = 0 then delay(1);
 if K = 20000 then DRdError := true;
end;
if DRdError = true then
begin
 badBeep;
 clrscr;
 writeln;
 writeln('   **** Data Retrieval Error ****');
 writeln;
 writeln('   Check the following:');
 writeln;
 writeln('     DDC112 securely in socket');
 writeln('     power supplies at 5V');
 writeln('     cables properly connected');
 writeln('     demo board "refreshed"');
 writeln('     PC port set correctly');
 writeln;
 writeln('    *****************************');
 writeln;
 writeln('    Hit ENTER to continue    ');
 readln;
 exit;
end
else
begin
 FScale := $FFFFF-$1000; {fullscale range = all ones - offset}
 for D := 1 to 4 do
 begin
  Ysum[D]   := 0;
  Ysumsq[D] := 0;
 end;
 writeln('retrieving data...');
 for N := Nt-1 downto 0 do
 begin
  for D := 1 to 4 do
  begin
   TRd := N + Nt*(D-1);
   Fnum := 0;
   PortDataRd := $6F;                {decrement Xilinx RAM memory address}
   PORT[wraddr] := PortDataRd;
   PORT[strbaddr] := 1;
   PORT[strbaddr] := 0;
   PORT[strbaddr] := 1;
   PORT[strbaddr] := 0;
   {prepare for RAM memory address              (PortDataRd := $6F;)}
   for iRd := 1 to 6 do                              {get 6 nibbles}
   begin
    PortDataRd := PortDataRd - $10;        {MSB, MSB-1,...,LSB nibble}
    PORT[wraddr] := PortDataRd;
    PORT[strbaddr] := 1;
    PORT[strbaddr] := 0;
    {wait for PC Interface Board Data Valid}
    K := 0;
    BusyBit3 := (PORT[readdr] AND $08) SHR 3;         {init bit 3}
```

```
      While (BusyBit3 <> 1) AND (K <= 20000) do
      begin
       BusyBit3 := (PORT[readdr] AND $08) SHR 3;
       inc(K);
       if (K mod 40) = 0 then delay(1);
       if K = 20000 then
       begin
        DRdError := true;
        N := 0;
       end;
      end;
      nib := ((PORT[readdr] XOR $80) AND $F0) SHR 4;
         {XOR inverts bit 7 (-busy), AND F0 gets rid of 4 lower bits,
          shift right puts the data bits in lower nibble}
      if iRd = 1 then
       SideRd := ((nib AND $4) Xor $4) SHR 2;      {bit3 lo ==> sideA}
      Fnum := Fnum SHL 4;
      FNum := Fnum OR nib;                 {Add nibble to final number}
     end;

     if FirstTime then
     begin
      if SideRd = 0 then FirstTime := false {first point is correct side}
      else
      begin
       FirstTime := false;
       for count := 1 to ((UserDDCCode-1)*2 + 1) do {read & throw away pts}
       begin
        PortDataRd := $6F;               {decrement Xilinx RAM Memory Address}
        PORT[wraddr] := PortDataRd;
        PORT[strbaddr] := 1;
        PORT[strbaddr] := 0;
        PORT[strbaddr] := 1;
        PORT[strbaddr] := 0;
        {prepare for RAM memory address  (PortDataRd := $6F;)}
        for iRd := 1 to 6 do                   {get 6 nibbles}
        begin
         PortDataRd := PortDataRd - $10;       {MSB, MSB-1,...,LSB nibble}
         PORT[wraddr] := PortDataRd;
         PORT[strbaddr] := 1;
         PORT[strbaddr] := 0;
         {wait For PC Interface Board DValid}
         K := 0;
         BusyBit3 := (PORT[readdr] AND $08) SHR 3;      {init bit 3}
         While (BusyBit3 <> 1) AND (K <= 20000) do
         begin
          BusyBit3 := (PORT[readdr] AND $08) SHR 3;
          inc(K);
          if (K mod 40) = 0 then delay(1);
          if K = 20000 then
          begin
           DRdError := true;
           N := 0;
          end;
         end;
        end;
       end;
       Fnum := 0;
       PortDataRd := $6F;            {decrement Xilinx RAM Memory Address}
       PORT[wraddr] := PortDataRd;
       PORT[strbaddr] := 1;
       PORT[strbaddr] := 0;
       PORT[strbaddr] := 1;
       PORT[strbaddr] := 0;
       {prepare for RAM memory address  (PortDataRd := $6F;)}
       for iRd := 1 to 6 do                        {get 6 nibbles}
       begin
        PortDataRd := PortDataRd - $10; {MSB, MSB-1,...,LSB nibble}
        PORT[wraddr] := PortDataRd;
        PORT[strbaddr] := 1;
        PORT[strbaddr] := 0;
        {wait for PC Interface Board Data Valid}
        K := 0;
        BusyBit3 := (PORT[readdr] AND $08) SHR 3;        {init bit 3}
```

```
        While (BusyBit3 <> 1) AND (K <= 20000) do
        begin
         BusyBit3 := (PORT[readdr] AND $08) SHR 3;
         inc(K);
         if (K mod 40) = 0 then delay(1);
         if K = 20000 then
         begin
          DRdError := true;
          N := 0;
         end;
        end;
        nib := ((PORT[readdr] XOR $80) AND $F0) SHR 4;
         {XOR inverts bit 7 (~busy), AND F0 gets rid of 4 lower bits,
         shift right puts the data bits in lower nibble}
        if iRd = 1 then
         SideRd := ((nib AND $4) Xor $4) SHR 2;      {bit3 lo ==> sideA}
        Fnum := Fnum SHL 4;
        FNum := Fnum OR nib;                         {add nibble to final number}
       end;
      end;
     end;

    Fnum := (FNum AND $000FFFFF);   {set bits 31-21 := 0}
    Fnum := Fnum - $1000;            {subtract offset}
    Ysum[D] := Ysum[D] + Fnum;
    temp := Fnum;
    temp := temp * Fnum;
    Ysumsq[D] := Ysumsq[D] + Temp;

    end;
   end;
  for D := 1 to 4 do
  begin
   Yave[D] :=  Ysum[D]/(Nt*FScale);
   temp :=  Nt*Ysumsq[D]-(Ysum[D]*Ysum[D]);
   Yrms[D] :=  Sqrt(abs(temp)/(Nt*(Nt-1)))/Fscale;
   Yrms[D] := Yrms[D] * 1e6;          {convert to ppm}
  end;
 end;

 xilinxWrite(6,CtrllCode OR $20);    {enable write to RAM}
end;

{*****************************************************************************}
procedure  retrieveData(var  err:  boolean);
{*****************************************************************************}
{Call readData then display results}
begin
 readData(err);
 if err = false then
 begin
  ClrScr;
  writeln;
  writeln(' # of pts = ',Nt,' Range = ',Range,' Tint = ',Tint:8:1, ' Test pkts = ',TPck);
  writeln;
  writeln('          average      rms noise');
  writeln('  1A: ',Yave[1]:11:7,'    ',Yrms[1]:6:2,' ppm');
  writeln('  2A: ',Yave[2]:11:7,'    ',Yrms[2]:6:2,' ppm');
  writeln('  1B: ',Yave[3]:11:7,'    ',Yrms[3]:6:2,' ppm');
  writeln('  2B: ',Yave[4]:11:7,'    ',Yrms[4]:6:2,' ppm');
 end;
end;

{*****************************************************************************}
procedure  TestModeLinearity;
{*****************************************************************************}
{Measure linearity of the DDC112's Test Mode}
{1st take 1 reading.  Use results to determine # of steps to fullscale.}
{Fit data with endpoint line and report max deviation from that line.}
var
 n,i           : integer;
 err           : boolean;
 userName      : string[8];
 fileName      : string[12];
 F1            : text;
 tpacket       : real;
 steps         : word;
 Tdat          : array[1..4,0..100] of real;  {holds data for lin fit}
 m,b           : real;
 INLpt,  INLmax  : real;
 INL           : array[1..4] of real;
```

11

```pascal
begin
 ClrScr;
 if Nt < 10 then
 begin
   writeln;
   writeln('***    The number of points / reading is low ***');
   writeln;
   writeln('     Increase the number for better results    ');
   badBeep;
   getInt('#  of  points',1,10000,Nt,err);
 end;

 writeln;
 writeln('Enter a file name for Test Mode Linearity data (max 8 characters)');
 readln(userName);
 writeln;
 fileName := userName + '.DAT';
 assign(F1,fileName);
 delay(1);
 {$I-} rewrite(F1); {$I+}
 if ioresult <> 0 then
 begin
   writeln('');
   writeln(' *** File I/O Problem, try a new name...');
   delay(400);
   badBeep;
   exit;
 end;

 setTstPckts(1);                    {set test pckts = 1 & collect 1st data}
 writeln(' collecting test data 1');
 readData(err);
 if err = false then
 begin                              {use 1st data pt to calc # steps required}
  for n := 1 to 4 do Tdat[n,1] := Yave[n];
   tpacket := (Yave[1])*100;   {calc packet size}
   writeln;
   writeln('*** Each test packet is ',tpacket:4:1,' % of full scale ***');
   steps := trunc(1/Yave[1]); {calc # of steps for fullscale}
   if steps > (trunc(Tint/5.4)) then
   begin
    steps := trunc(Tint/5.4);
    writeln;
    writeln('**********************************************');
    writeln('Test Mode will not be able to reach full scale');
    writeln('with current Tint.  Increasing Tint will allow');
    writeln('more test packets dumps during the integration.');
    writeln('**********************************************');
    badBeep;
   end;
  end
  else exit;

  for i := 2 to steps do  {collect rest of data}
  begin
   writeln;
   writeln(' collecting test data ',i,' out of ',steps);
   setTstPckts(i);
   readData(err);
   if err = true  then exit;
   for n := 1 to 4 do Tdat[n,i] := Yave[n];
  end;
  setTstPckts(Tpck);                {restore user Test Package setting}

  ClrScr;
  writeln;
  writeln('    Linearity Results: Endpoint Fit');
  writeln('    (max deviation from endpoint line)');
  writeln;
```

```pascal
     for n := 1 to 4 do               {fit linearity}
     begin
      b := Tdat[n,1];                 {y = mx + b}
      m := (Tdat[n,steps] - Tdat[n,1])/(steps-1);
      INLmax := 0;
      for i := 2 to (steps-1) do {INL for i=1 & steps =0 for endpoint fit}
      begin
       INLpt := Abs(Tdat[n,i] - (m*(i-1) + b));
        if INLpt > INLmax then INLmax := INLpt;
       end;
      INL[n] := 1e6* INLmax ;         {convert to ppm}
      case n of
       1: writeln('   INL  for  1a = ',INL[1]:6:1,' ppm');
       2: writeln('   INL  for  2a = ',INL[2]:6:1,' ppm');
       3: writeln('   INL  for  1b = ',INL[3]:6:1,' ppm');
       4: writeln('   INL  for  2b = ',INL[4]:6:1,' ppm');
      end;
     end;

    writeln(F1,'          Burr-Brown Corporation        ');
    writeln(F1,'        Application Bulletin AB-135     ');
    writeln(F1,'DDC112 Test Mode linearity measurement');
    writeln(F1);
    writeln(F1,'# of averages/readings = ',Nt);
    writeln(F1,'Range  =  ',Range);
    writeln(F1,'Tint  =  ',Tint:7:1);
    writeln(F1);
    writeln(F1,'#  Test');
    writeln(F1,'Packets        1a ave        2a ave        1b ave        2b ave');
    for i := 1 to steps do
    writeln(F1,i:3,'         ',Tdat[1,i]:11:6,'  ',Tdat[2,i]:11:6,'  ',Tdat[3,i]:11:6,'  ',Tdat[4,i]:11:6);
    writeln(F1);
    writeln(F1,'  Endpoint  Fit');
    writeln(F1,'  INL(ppm):  ',INL[1]:8:1,  INL[2]:12:1,  INL[3]:12:1,  INL[4]:12:1);
    close(F1);

    goodBeep;
    writeln;
    writeln('    Hit  ENTER  to  continue...');
    readln;
   end;

{****************************************************************************}
{****************************************************************************}
{Main}
{****************************************************************************}
{****************************************************************************}
var
 userinput                 :  string[10];
 goodbye,done              :  boolean;
 err                       :  boolean;
 choice                    :  word;
 check                     :  integer;
 minTint                   :  real;

begin
 Range    := 5;
 Tint     := 500;
 Nt       := 500;
 TPck     := 1;
 PCPort   := 1;
 DataCkCode              := 2;
 SysCkCode              := 0;
 DXmitDelayCode          := 0;
 UserDDCCode             := 1;
 Ctrl1Code               := $20;                {initially Read, internal DCLk}
 Ctrl2Code               := 1;                  {demo bd CONV}
 pPrintPort              := Ptr($40,$08);       {default: PC port=1}
 wraddr                  := pPrintPort^;
 readdr                  := wraddr + 1;
 strbaddr                := wraddr + 2;
 PORT[strbaddr]          := 0;                  {init Strobe at 0 (really, 1 out)}
```

```pascal
xilinxRefresh;
ClrScr;
goodbye := false;
while (goodbye <> true) do
begin
 ClrScr;
 writeln;
 writeln('---------------------------------------');
 writeln('   |        Burr-Brown Corporation      |');
 writeln('   |        Application Bulletin AB1XX  |');
 writeln('   |               |');
 writeln('   | DDC112 Test Mode Evaluation Program');
 writeln('     ───────────────────');
 writeln;
 writeln('    # points/reading = ',Nt);
 writeln('               Range = ',Range);
 writeln('                Tint = ',Tint:7:1);
 writeln('        # test packets = ',TPck);
 writeln;
 writeln;
 writeln('   ==========================   ');
 writeln('   Choose  one  of  the  following ');
 writeln('   ==========================   ');
 writeln;
 writeln('    1) Refresh Demo Board');
 writeln;
 writeln('    2) Set # points averaged/reading');
 writeln('    3) Set Range');
 writeln('    4) Set Tint');
 writeln('    5) Set # of Test Mode packets');
 writeln('    6) Set PC port');
 writeln;
 writeln('    7) Take single reading');
 writeln('    8) Measure Linearity of Test Mode');
 writeln;
 writeln('    9) exit program');
 writeln;
 readln(userinput);
 val(userinput,choice,check);
 if check <> 0 then badBeep
 else
 begin
  if (choice < 0) or (choice > 9) then badBeep
  else
   case choice of
     1: begin
          writeln;
          writeln('Refreshing Demo Board...');
          xilinxRefresh;
        end;

     2: getInt('# of points',1,10000,Nt,err);

     3: begin
          getInt('Range',0,7,Range,err);
          if err = false then setRange(Range);
        end;

     4: begin
          getReal('Tint',0,1500000,Tint,err);
          if err = false then setTint(Tint);
        end;
```

```pascal
  5:  begin
        getInt('Test  Mode  Packets',0,128,TPck,err);
        if err = false then
        begin
          if TPck > Trunc(Tint/5.4) then    {allow 5.4us per packet}
          begin
            writeln;
            writeln('****************************************************');
            writeln('  # of Test Packets is too high for current Tint);
            minTint := TPck*5.4;
            writeln('  Tint must be > ',minTint:7:1,' us for ',TPck,' packets.');
            TPck := Trunc(Tint/5.4);
            writeln('  Setting # of Test Packets to ',TPck);
            writeln('****************************************************');
            writeln;
            writeln('      Hit ENTER to continue...');
            BadBeep;
            readln;
          end;
          setTstPckts(TPck);
        end;
      end;

  6:  begin
        getInt('PC  port',1,2,PCport,err);
        setPCport(PCport);
      end;

  7:  begin
        done := false;
        while done = false do
        begin
          retrieveData(err);
          if err = true then done := true
          else
          begin
            writeln;
            writeln('  enter "r" to repeat measurement');
            readln(userinput);
            if (userinput <> 'r') AND (userinput <> 'R')
            then done := true;
          end;
        end;
      end;

  8:  TestModeLinearity;

  9: goodbye := true;
    end;
  end;
 end;
end.
```

IMPORTANT NOTICE

Texas Instruments and its subsidiaries (TI) reserve the right to make changes to their products or to discontinue any product or service without notice, and advise customers to obtain the latest version of relevant information to verify, before placing orders, that information being relied on is current and complete. All products are sold subject to the terms and conditions of sale supplied at the time of order acknowledgment, including those pertaining to warranty, patent infringement, and limitation of liability.

TI warrants performance of its semiconductor products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are utilized to the extent TI deems necessary to support this warranty. Specific testing of all parameters of each device is not necessarily performed, except those mandated by government requirements.

Customers are responsible for their applications using TI components.

In order to minimize risks associated with the customer's applications, adequate design and operating safeguards must be provided by the customer to minimize inherent or procedural hazards.

TI assumes no liability for applications assistance or customer product design. TI does not warrant or represent that any license, either express or implied, is granted under any patent right, copyright, mask work right, or other intellectual property right of TI covering or relating to any combination, machine, or process in which such semiconductor products or services might be or are used. TI's publication of information regarding any third party's products or services does not constitute TI's approval, warranty or endorsement thereof.