

A CLARIFICATION OF USE HIGH-SPEED S/H TO IMPROVE SAMPLING ADC PERFORMANCE

by Rick Downs, (520) 746-7488

You know it's going to be one of those days when you see the printed version of an article you wrote and realize that you have made an error in the presentation of your ideas. This is what happened to me as I read *Use High Speed S/H to Improve Sampling ADC Performance (Design Update, Vol. 1, No. 1)*. This article will rectify the situation and further illuminate some important performance aspects of the ADS7800.

After having spent three weeks staring at the display of an Audio Precision distortion analyzer and trying to track down the jitter sources in a digital audio reconstruction board, I did the experiments with the ADS7800 and SHC804. In the former project, I could not distinguish between harmonic distortion and other spurious frequency components, due to the nature of the measurement. In the latter, all we did measure was harmonic distortion (aside from SNR). And this is where I made my mistake; so let me set the record straight and tell you: **In all but the most contrived cases, jitter does NOT cause HARMONIC distortion!**

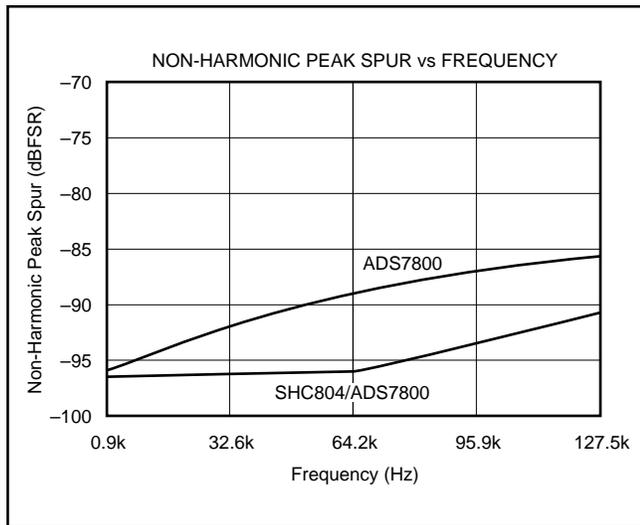


FIGURE 1. The Level of Non-Harmonic Spurious Signal Components is Improved by Using the Lower-Jitter Sampling Mechanism of the SHC804. Note that even without the SHC804, non-harmonic spurs are below -85dB up to the Nyquist frequency.

Jitter causes spurious frequency components, and the level of the spurs is dependent upon the rms value of the jitter, and the frequency of the signal being digitized, as explained in the article in Vol. 1, No. 1. This will cause a degradation in SNR.

Therefore, the graph from *Design Update, Vol. 1, No. 1* showing the improvement in THD with the SHC804 preceding the ADS7800 really does not illustrate the results of reducing jitter. The correct results can be seen in Figure 1. The level of spurious frequencies is improved significantly by using the lower-jitter sampling mechanism of the SHC804.

So why does the THD improve by adding the SHC804 if harmonic distortion is not caused by jitter? The cause of the harmonic distortion in this case is a function of the sample/hold in the ADS7800. The on-resistance of the sampling switch changes with input signal amplitude, causing a changing phase lag in the sampling mechanism. This results in even-order harmonic distortion. A close look at Figure 2 will reveal the largest spur is the second harmonic of the input signal. (A complete explanation of this phenomenon, as well as other information on using the ADS7800 for dynamic applications, will be the subject of a forthcoming Application Note).

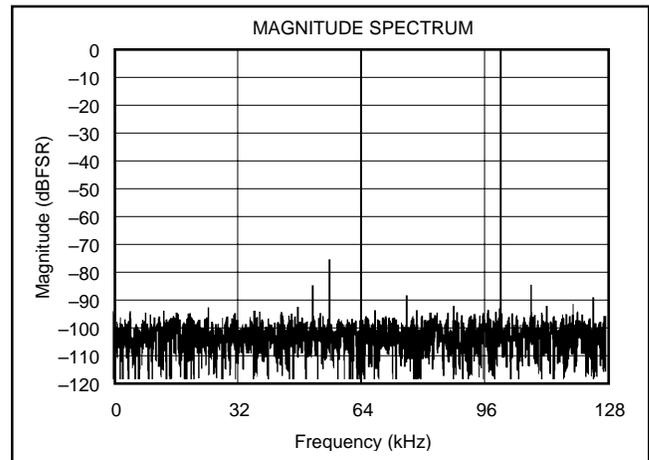


FIGURE 2. Spectral Performance of ADS7800 Digitizing a Full-Scale 100kHz Sine Wave at a 256kHz Sampling Rate. The largest frequency component (aside from the fundamental) is the second harmonic at -76dB.

This phenomenon is present in **all** monolithic sampling ADCs—not just the ADS7800. In fact, we spent considerable time and effort here at Burr-Brown creating a design that minimized this distortion. A monolithic sampling 12-bit converter yielding spectral results such as those in Figure 2 is remarkable! (To add insult to injury, the FFTs originally published were performed on an early version of the

ADS7800, which gave a much larger second harmonic. I was quickly informed that we had improved the ADS7800 since then, and had **never** shipped ADS7800s like the one I had used for my experiments.)

With the SHC804 in front of the ADS7800, the ADS7800's input sample/hold sees essentially DC, reducing harmonic distortion. (Request PDS-1018 for ADS7800 and PDS-512 for SHC804.)

The information provided herein is believed to be reliable; however, BURR-BROWN assumes no responsibility for inaccuracies or omissions. BURR-BROWN assumes no responsibility for the use of this information, and all use of such information shall be entirely at the user's own risk. Prices and specifications are subject to change without notice. No patent rights or licenses to any of the circuits described herein are implied or granted to any third party. BURR-BROWN does not authorize or warrant any BURR-BROWN product for use in life support devices and/or systems.

IMPORTANT NOTICE

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, modifications, enhancements, improvements, and other changes to its products and services at any time and to discontinue any product or service without notice. Customers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All products are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its hardware products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by government requirements, testing of all parameters of each product is not necessarily performed.

TI assumes no liability for applications assistance or customer product design. Customers are responsible for their products and applications using TI components. To minimize the risks associated with customer products and applications, customers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any TI patent right, copyright, mask work right, or other TI intellectual property right relating to any combination, machine, or process in which TI products or services are used. Information published by TI regarding third-party products or services does not constitute a license from TI to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. Reproduction of this information with alteration is an unfair and deceptive business practice. TI is not responsible or liable for such altered documentation.

Resale of TI products or services with statements different from or beyond the parameters stated by TI for that product or service voids all express and any implied warranties for the associated TI product or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

Mailing Address:

Texas Instruments
Post Office Box 655303
Dallas, Texas 75265