



Buy







LDC1101

ZHCSDS7A-MAY 2015-REVISED JUNE 2015

LDC1101 1.8V 高分辨率、高速电感数字转换器

特性 1

- 宽工作电压范围: 1.8V 至 3.3V
- 传感器频率范围: 500kHz 至 10MHz
- **R** 分辨率: 16 位
- L 分辨率: 16/24 位
- 180kSPS 转换速率
- 阈值检测功能
- R_p测量的器件间偏差为 1%
- 电源电流:
 - 关断模式下为 1.4µA
 - 休眠模式下为 135µA
 - 激活模式下为 1.9mA (未连接传感器)
- 距离分辨率可达亚微米级
- 支持远程放置传感器,以便将 LDC 与恶劣环境隔 离
- 可防水、油、污垢、灰尘等环境干扰 •
- 外部组件数极少
- 无磁体操作
- 工作温度范围: -40℃ 至 125℃

2 应用

- 高速轮齿计数
- 高速事件计数
- 电机转速感测 .
- 家用电器、汽车和消费类应用中的旋钮和拨盘
- 家用电器、汽车和消费类应用中的人机界面 (HMI)
- 按钮和键盘
- 电机控制 •
- 金属探测

简化电路原理图 4

3 说明

LDC1101 是一款 1.8V 至 3.3V、高分辨率电感数字转 换器,可对位置、旋转或运动进行短距离、高速、无触 点感测,即使存在污垢或灰尘也能够实现可靠、精确的 测量,非常适合户外或严苛环境。

LDC1101 特有双感应测量内核,可在执行 > 150ksps 的 16 位 R_P 和 L 测量的同时,进行分辨率高达 24 位 的高分辨率 L 测量,采样速率可高达 180ksps 以上。 LDC1101 包含阈值比较功能,该功能可在器件运行时 动态更新。


电感感测技术可实现对线性/角位置、位移、运动、压 缩、振动、金属成分以及市面上包括汽车、消费类、计 算机、工业、医疗和通信应用在内的很多其他应用的高 精度测量。 电感感测技术能够以低于其他竞争对手解 决方案的成本提供更为出色的性能和可靠性。

LDC1101 在小型 3mm × 3mm 10 引脚 VSON 封装内 即可提供这些电感感测技术优势。 微控制器可使用 4 引脚 SPI™轻松配置 LDC1101。

器件信息(1)

器件型号	封装	封装尺寸(标称值)
LDC1101	VSON (10)	3.00mm × 3.00mm

(1) 如需了解所有可用封装,请见数据表末尾的可订购产品附录。

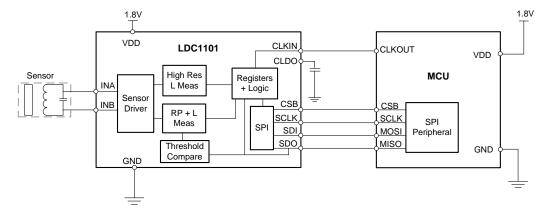

An IMPORTANT NOTICE at the end of this data sheet addresses availability, warranty, changes, use in safety-critical applications, intellectual property matters and other important disclaimers. PRODUCTION DATA.



11.1 Layout Guidelines 44

目	录

8.5

8.6

9.1

12.1 12.2

9

1	特性	
2	应用	1
3	说明	1
4	简化	电路原理图1
5	修订	历史记录
6	Pin	Configuration and Functions 3
7	Spe	cifications
	7.1	Absolute Maximum Ratings 4
	7.2	ESD Ratings 4
	7.3	Recommended Operating Conditions 4
	7.4	Thermal Information 4
	7.5	Electrical Characteristics5
	7.6	Digital Interface 5
	7.7	Timing Requirements 6
	7.8	Typical Characteristics 7
8	Deta	ailed Description
	8.1	Overview
	8.2	Functional Block Diagram 9
	8.3	Feature Description9

5 修订历史记录

Changes from Original (May 2015) to Revision A			
• 已添加 完整数据表以替代产品预览	1		



8.4 Device Functional Modes..... 10

Application and Implementation 29

11.2 Layout Example 45 12 器件和文档支持 46

器件支持 46

12.3 社区资源...... 46 12.5 静电放电警告...... 46 13 机械、封装和可订购信息...... 46

Programming...... 12 Register Maps 14

10 Power Supply Recommendations 44 11 Layout...... 44

www.ti.com.cn



6 Pin Configuration and Functions

DRC Package 10-Pin VSON Top View						
SDO/INTB	1	7	<u> </u>	CLDO		
CLKIN			9	VDD		
SCLK	_3_1	DAP	<u> 8 </u>	GND		
SDI	4!			INA		
CSB	5!		6	INB		

Pin Functions

PIN	1	TYPE ⁽¹⁾	DESCRIPTION
NAME	NO.	ITPE	DESCRIPTION
CLDO	10	Р	Internal LDO bypassing pin. A 15 nF capacitor must be connected from this pin to GND.
CLKIN	2	I	External time-base Clock Input
CSB	5	I	SPI CSB. Multiple devices can be connected on the same SPI bus and CSB can be used to uniquely select desired device
DAP	-	-	Connect to Ground for improved thermal performance ⁽²⁾
GND	8	G	Ground
INA	7	А	External LC tank – connected to external LC tank
INB	6	А	External LC tank – connected to external LC tank
SCLK	3	I	SPI Clock Input
SDI	4	I	SPI Data Input – connect to MOSI of SPI master
SDO/INTB	1	0	SPI Data Output/INTB – Connect to MISO of SPI Master. When CSB is high, this pin is High-Z. Alternatively, this pin can be configured to function as INTB
VDD	9	Р	Power Supply

(1) P= Power, G=Ground, I=Input, O=Output, A=Analog

(2) There is an internal electrical connection between the exposed Die Attach Pad (DAP) and the GND pin of the device. Although the DAP can be left floating, for best performance the DAP should be connected to the same potential as the device's GND pin. Do not use the DAP as the primary ground for the device. The device GND pin must always be connected to ground.

7 Specifications

7.1 Absolute Maximum Ratings

over operating free-air temperature range (unless otherwise noted)⁽¹⁾

		MIN	MAX	UNIT
V_{DD}	Supply voltage range		3.6	V
V	Voltage on INA, INB	-0.3	2.3	V
Vi	Voltage on CLDO	-0.3	1.9	V
	Voltage on any other pin ⁽²⁾	-0.3	V _{DD} +0.3	V
TJ	Junction temperature	-55	125	°C
T _{stg}	Storage temperature	-65	125	°C

(1) Stresses beyond those listed under Absolute Maximum Ratings may cause permanent damage to the device. These are stress ratings only, which do not imply functional operation of the device at these or any other conditions beyond those indicated under Recommended Operating Conditions. Exposure to absolute-maximum-rated conditions for extended periods may affect device reliability.

(2) Maximum voltage across any two pins is V_{DD} +0.3.

7.2 ESD Ratings

			VALUE	UNIT
V	Electrostatic	Human-body model (HBM), per ANSI/ESDA/JEDEC JS-001 ⁽¹⁾	±2000	V
V _(ESD)	discharge	Charged-device model (CDM), per JEDEC specification JESD22-C101 ⁽²⁾	±1000	v

(1) JEDEC document JEP155 states that 500-V HBM allows safe manufacturing with a standard ESD control process.

(2) JEDEC document JEP157 states that 250-V CDM allows safe manufacturing with a standard ESD control process.

7.3 Recommended Operating Conditions

over operating free-air temperature range (unless otherwise noted)

		MIN	NOM MAX	UNIT
V_{DD}	Supply voltage	1.71	3.46	i V
TJ	Junction temperature	-40	125	5°C

7.4 Thermal Information

	THERMAL METRIC ⁽¹⁾	DRC (VSON)	UNIT
		10 PINS	
R _{θJA}	Junction-to-ambient thermal resistance	44.2	°C/W
R _{0JC(top)}	Junction-to-case (top) thermal resistance	50.1	°C/W
$R_{\theta JB}$	Junction-to-board thermal resistance	19.6	°C/W
Ψ_{JT}	Junction-to-top characterization parameter	0.7	°C/W
Ψ_{JB}	Junction-to-board characterization parameter	19.8	°C/W
R _{0JC(bot)}	Junction-to-case (bottom) thermal resistance	4.4	°C/W

(1) For more information about traditional and new thermal metrics, see the Semiconductor and IC Package Thermal Metrics application report, SPRA953.



7.5 Electrical Characteristics

Over recommended operating conditions unless otherwise noted, $V_{DD} = 1.8 \text{ V}$, $T_{A} = 25^{\circ}\text{C}$.

	PARAMETER	TEST CONDITION ⁽¹⁾	MIN ⁽²⁾	TYP ⁽³⁾	MAX ⁽²⁾	UNIT
POWER		· · · · · ·				
V _{DD}	Supply voltage		1.71		3.46	V
I _{DD}	Supply current	START_CONFIG= 0x00, no sensor connected		1.9	2.7	mA
I _{DDS}	Supply current including sensor current	f_{CLKIN} = 16 MHz, f_{SENSOR} = 2 MHz, START_CONFIG = 0x00		3.2		mA
IDDSL	Sleep mode supply current	START_CONFIG =0x01		135	180	μA
I _{SD}	Shutdown mode supply current			1.4	6.7	μA
SENSOR		l				
	R _P Measurement part-to-part variation	$\begin{array}{l} RESP_TIME=6144, D_CONFIG=0x00, \\ ALT_CONFIG=0x00, START_CONFIG=0x00, \\ f_{SENSOR} = 2 \ MHz \end{array}$		1%		
I _{SENSORMAX}	Sensor maximum current drive	RP_MIN = b111, START_CONFIG=0x00, D_CONFIG=0x00, ALT_CONFIG=0x00	0.598	0.6	0.602	mA
ISENSORMIN	Sensor minimum current drive	RP_MAX = b000, RPMAX_DIS=b0, START_CONFIG=0x00, D_CONFIG=0x00, ALT_CONFIG=0x00		4.7		μA
$f_{\rm SENSOR}$	Sensor resonant frequency	Device settings and Sensor compliant as detailed in LDC1101 R _P Configuration	0.5		10	MHz
RP _{RES}	R _P Measurement resolution			16		bits
	Inductance sensing resolution – R _P +L Mode			16		bits
L _{RES}	Inductance sensing resolution – LHR Mode			24		bits
A _{OSC}	Sensor oscillation amplitude	INA – INB, START_CONFIG=0x00, D_CONFIG=0x00, ALT_CONFIG=0x00		1.2		V_{PP}
DETECTION	1					
t _{S_MIN}	Minimum response time (RP+L mode)	R _P +L Mode, RESP_TIME=b010		192 ÷f _{SENSOR}		S
t _{S_MAX}	Maximum response time (RP+L mode)	R _P +L Mode, RESP_TIME=b111		6144 ÷f _{SENSOR}		S
T _{s_MAX}	High Res L maximum measurement interval	LHR_REF_COUNT=0xFFFF, START_CONFIG=0x00		(2 ²⁰ +39) ÷f _{CLKIN}		S
SR _{MAXRP}	RP+L Mode maximum sample rate	f_{CLKIN} =16 MHz, f_{SENSOR} = 10 MHz, RESP_TIME=b010		156.25		kSPS
S _{RMAXL}	High Res L Mode Maximum Sample Rate	High Resolution L Mode, LHR_REF_COUNT=0x0002, <i>f</i> _{CLKIN} =16 MHz		183.8		kSPS
FREQUENC	YREFERENCE					
f _{CLKIN}	Reference input frequency		1		16	MHz
DC _{fin}	Reference duty cycle		40%		60%	
VIH	Input high voltage (Logic "1")			$0.8 \times V_{DD}$		V
V _{IL}	Input low voltage (Logic "0")			$0.2 \times V_{DD}$		V

(1) Register values are represented as either binary (b is the prefix to the digits), or hexadecimal (0x is the prefix to the digits). Decimal values have no prefix.

Limits are ensured by testing, design, or statistical analysis at 25°C. Limits over the operating temperature range are ensured through (2) correlation using statistical quality control (SQC) method.

Typical values represent the most likely parametric norm as determined at the time of characterization. Actual typical values may vary (3) over time and will also depend on the application and configuration. The typical values are not tested and are not guaranteed on shipped production material.

7.6 Digital Interface

	PARAMETER	MIN	TYP	MAX	UNIT
VOLTA	/OLTAGE LEVELS				V
VIH	Input high voltage (Logic "1")			$0.2 \times V_{DD}$	V
VIL	Input low voltage (Logic "0")		V _{DD} -0.3		V
V _{OH}	Output high voltage (Logic "1", I _{SOURCE} = 400 µA)			0.3	V
V _{OL}	Output low voltage (Logic "0", I _{SINK} = 400 µA)	-500		500	nA
I _{OHL}	Digital IO leakage current				

EXAS

www.ti.com.cn

7.7 Timing Requirements

		MIN	TYP	MAX	UNIT
t _{START}	Start-up time from shutdown to sleep		0.8		ms
t _{WAKE}	Wake-up time (from completion of SPI to conversion start; does not include sensor settling time)		0.04		ms
INTERFA	CE TIMING REQUIREMENTS ⁽¹⁾				
$f_{\rm SCLK}$	Serial clock frequency			8	MHz
t _{wH}	SCLK pulse-width high	0.4 / f _{SCLK}			s
t _{wL}	SCLK pulse-width low	0.4 / f _{SCLK}			s
t _{su}	SDI setup time	10			ns
t _h	SDI hold time	10			ns
t _{ODZ}	SDO driven-to-tristate time			25	ns
t _{OZD}	SDO tristate-to-driven time			25	ns
t _{OD}	SDO output delay time			20	ns
t _{su(CS)}	CSB setup time	20			ns
t _{h(CS)}	CSB hold time	20			ns
t _{IAG}	CSB inter-access interval	100			ns
t _{w(DRDY)}	Data ready pulse width	1.	/f _{sensor}		ns

(1) Unless otherwise noted, all limits specified at $T_A = 25^{\circ}$ C, $V_{DD} = 1.8$ V, 10 pF capacitive load in parallel with a 10 k Ω load on the SDO pin. Specified by design; not production tested.




Figure 1. Write Timing Diagram


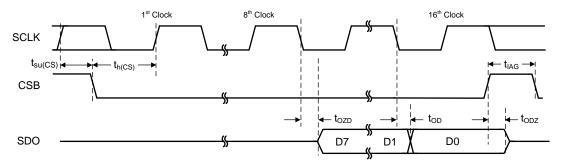


Figure 2. Read Timing Diagram




7.8 Typical Characteristics

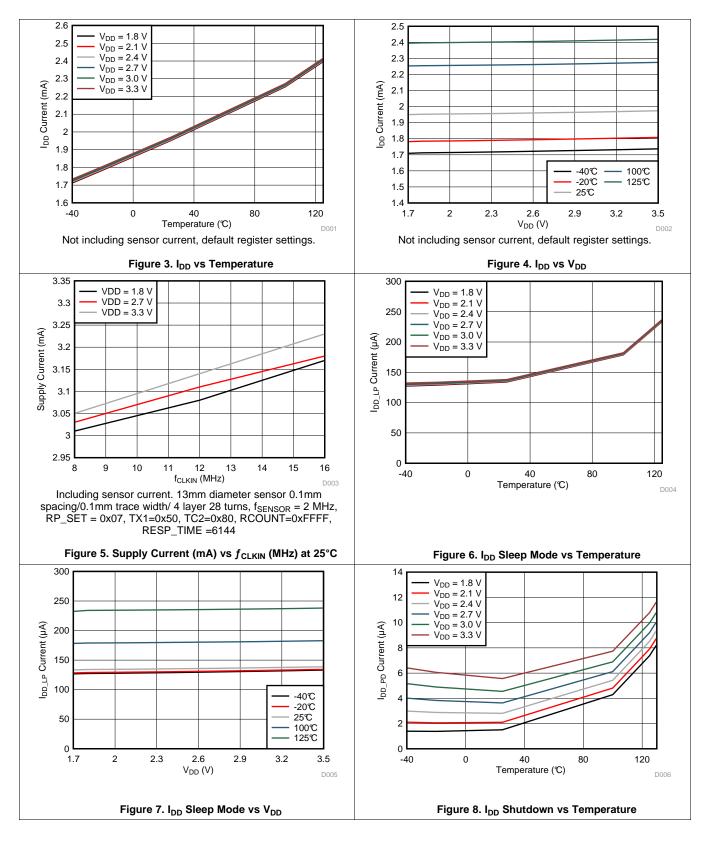

LDC1101 ZHCSDS7A-MAY 2015-REVISED JUNE 2015

Typical Characteristics (continued)

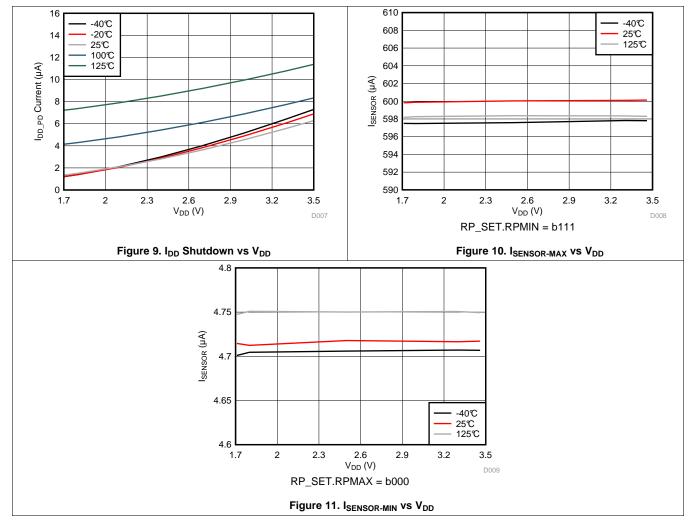

www.ti.com.cn



8 Detailed Description

8.1 Overview

The LDC1101 is an inductance-to-digital converter which can simultaneously measure the impedance and resonant frequency of an LC resonator. The high resolution measurement capability enables this device to be used to directly measure changes in physical systems, allowing the resonator to sense the proximity and movement of conductive materials.


The LDC1101 measures the impedance and resonant frequency by regulating the oscillation amplitude in a closed-loop configuration at a constant level, while monitoring the energy dissipated by the resonator. By monitoring the amount of power injected into the resonator, the LDC1101 can determine the equivalent parallel resistance of the resonator, R_p , which it returns as a digital value.

In addition, the LDC1101 device also measures the oscillation frequency of the LC circuit by comparing the sensor frequency to a provided reference frequency. The sensor frequency can then be used to determine the inductance of the LC circuit.

The threshold comparator block can compare the RP+L conversion results versus a programmable threshold. With the threshold registers programmed and comparator enabled, the LDC1101 can provide a switch output, reported as a high/low level on the INTB/SDO pin.

The LDC1101 device supports a wide range of LC combinations with oscillation frequencies ranging from 500 kHz to 10 MHz and R_P ranging from 1.25 k Ω to 90 k Ω . The device is configured and conversion results retrieved through a simple 4-wire SPI. The power supply for the device can range from 1.8 V – 5% to 3.3 V + 5%. The only external components necessary for operation are a 15 nF capacitor for internal LDO bypassing and supply bypassing for VDD.

8.2 Functional Block Diagram

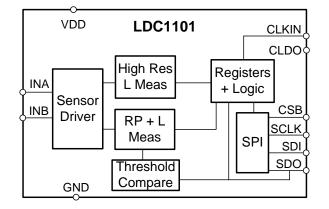

8.3 Feature Description

8.3.1 Sensor Driver

The LDC1101 can drive a sensor with a resonant frequency of 500 kHz to 10 MHz with an R_P in the range of 1.25 k Ω to 90 k Ω . The nominal sensor amplitude is 1.2 V. The sensor Q should be at least 10 for R_P measurements. The inductive sensor must be connected across the INA and INB pins. The resonant frequency of the sensor is set by:

$$f_{\text{SENSOR}}(\text{Hz}) = \frac{1}{2\pi\sqrt{L \times C}}$$

where

- L is the sensor inductance in Henrys, and
- C is the sensor parallel capacitance in Farads.

(1)



8.4 Device Functional Modes

8.4.1 Measurement Modes

The LDC1101 features two independent measurement subsystems to measure the impedance and resonant frequency of an attached sensor. The R_P+L subsystem can simultaneously measure the impedance and resonant frequency of an LC resonator, with up to 16 bits of resolution for each parameter. Refer to R_P+L *Measurement Mode* for more information on the R_P+L measurement functionality.

The High Resolution L (LHR) subsystem measures the sensor resonant frequency with up to 24 bits of resolution. The effective resolution is a function of the sample rate and the reference frequency supplied on the CLKIN pin. Refer to *High Resolution L (LHR) Measurement Mode* for more information on the LHR measurement functionality.

Both measurement subsystems can convert simultaneously but at different sample intervals – the completion of an R_P+L conversion will be asynchronous to the completion of a LHR conversion.

	RP+L Mode	LHR Mode
R _P Measurement Resolution	16 bits	N/A
L Measurement Resolution	16 bits	24 bits
Sample Rate configuration	Varies with f_{SENSOR} , set by RESP_TIME	Fixed and set by RCOUNT field and f_{CLKIN}
Sample rate at highest resolution (SPS)	244	15.3
Maximum Sample Rate (kSPS)	156.25	183.9
L Resolution at Maximum Sample rate	6.7 bits	6.5 bits
Switch Output on SDO/INTB	Available for R _P or L output code	N/A

Table 1. Comparison of Measurement Modes

8.4.2 R_P+L Measurement Mode

In RP+L mode, the LDC1101 will simultaneously measure the impedance and resonant frequency of the attached sensor. The device accomplishes this task by regulating the oscillation amplitude in a closed-loop configuration to a constant level, while monitoring the energy dissipated by the resonator. By monitoring the amount of power injected into the resonator, the LDC1101 device can determine the value of R_P. The device returns this value as a digital value which is proportional to R_P. In addition, the LDC1101 device can also measure the oscillation frequency of the LC circuit, by counting the number of cycles of a reference frequency. The measured sensor frequency can be used to determine the inductance of the LC circuit.

8.4.2.1 RPMIN and RPMAX

The variation of R_P in a given system is typically much smaller than maximum range of 1.25 k Ω to >90 k Ω supported by the LDC1101. To achieve better resolution for systems with smaller R_P ranges, the LDC1101 device offers a programmable R_P range.

The LDC1101 uses adjustable current drives to scale the R_P measurement range; by setting a tighter current range a higher accuracy R_P measurement can be performed. This functionality can be considered as a variable gain amplifier (VGA) front end to an ADC. The current ranges are configured in the RPMIN and RPMAX fields of register RP_SET (address 0x01). Refer to LDC1101 R_P Configuration for instructions to optimize these settings.

8.4.2.2 Programmable Internal Time Constants

The LDC1101 utilizes internal programmable registers to configure time constants necessary for sensor oscillation. These internal time constants must be configured for R_P measurements. Refer to *Setting Internal Time Constant 1* and *Setting Internal Time Constant 2* for instructions on how to configure them for a given system.

8.4.2.3 R_P+L Mode Measurement Sample Rate

The LDC1101 provides an adjustable sample rate for the RP+L conversion, where longer conversion times have higher resolution. Refer to *RP+L Sample Rate Configuration with RESP_TIME* for more details.



8.4.3 High Resolution L (LHR) Measurement Mode

The High Resolution L measurement (LHR) subsystem provides a high-resolution inductance (L) measurement of up to 24 bits. This L measurement can be configured to provide a higher resolution measurement than the measurement returned from the RP+L subsystem. The LHR subsystem also provides a constant conversion time interval, whereas the RP+L conversion interval is a function of the sensor frequency. The LHR measurement runs asynchronously with respect to the RP+L measurement.

8.4.4 Reference Count Setting

The LHR sample rate is set by the Reference Count (LHR_RCOUNT) setting (registers 0x30 and 0x31). The LHR conversion resolution is proportional to the programmed RCOUNT value. With the maximum supported 16 MHz CLKIN input, the LDC1101 conversion interval can be set from 8.6 μ s to 87.38 ms in 1 μ s increments. Note that longer conversion intervals produce more accurate LHR measurements. Refer to *LHR Sample Rate Configuration with RCOUNT* for more details.

8.4.5 L-Only Measurement Operation

The LDC1101 can disable the R_P measurement to perform a more stable L measurement. To enable this mode, set:

- ALT_CONFIG.LOPTIMAL(register 0x05-bit0) = 1
- D_CONFIG.DOK_REPORT (register 0x0C-bit0) = 1

When this mode is used, R_P measurement results are not valid.

8.4.6 Minimum Sensor Frequency and Watchdog Setting

The LDC1101 can report an error condition if the sensor oscillation stops. Refer to *MIN_FREQ* and *Watchdog Configuration* for information on the configuration of the watchdog.

8.4.7 Low Power Modes

When continuous LDC conversions are not required, the LDC1101 supports two reduced power modes. In Sleep mode, the LDC1101 retains register settings and can quickly enter active mode for conversions. In Shutdown mode, power consumption is significantly lower, although the device configuration is not retained. While in either low power mode, the LDC1101 will not perform conversions.

8.4.7.1 Shutdown Mode

Shutdown mode is the lowest power state for the LDC1101. Note that entering SD mode will reset all registers to their default state, and so the device must have its registers rewritten. To enter Shutdown, perform the following sequence:

- 1. Set ALT_CONFIG.SHUTDOWN_EN = 1 (register 0x05-bit[1]).
- 2. Stop toggling the CLKIN pin input and drive the CLKIN pin Low.
- 3. Set START_CONFIG.FUNC_MODE = b10 (register 0x0B:bits[1:0]). This register can be written while the LDC1101 is in active mode; on completion of the register write the LDC1101 will enter shutdown.

To exit Shutdown mode, resume toggling the clock input on the CLKIN pin; the LDC1101 will transition to Sleep mode with the default register values.

While in Shutdown mode, no conversions are performed. In addition, entering Shutdown mode will clear the status registers; if an error condition is present it will not be reported when the device exits Shutdown mode.

8.4.7.2 Sleep Mode

Sleep mode is entered by setting START_CONFIG.FUNC_MODE =b01 (register 0x0B:bits[1:0]). While in this mode, the register contents are maintained. To exit Sleep mode and start active conversions, set START_CONFIG.FUNC_MODE = b00. While in Sleep mode the SPI interface is functional so that register reads and writes can be performed.

On power-up or exiting Shutdown mode, the LDC1101 will be in Sleep mode.

LDC1101 ZHCSDS7A – MAY 2015 – REVISED JUNE 2015

Configuring the LDC1101 must be done while the device is in Sleep mode. If a setting on the LDC1101 needs to be changed, return the device to Sleep mode, change the appropriate register, and then return the LDC1101 to conversion mode. The registers related to INTB reporting can be changed while the LDC1101 is in active mode. Refer to *INTB Reporting on SDO* for more details.

8.4.8 Status Reporting

The LDC1101 provides 2 status registers, STATUS and LHR_STATUS, to report on the device and sensor condition.

NAME	FIELD	FUNCTION				
NO_SENSOR_OSC	7	When the resonance impedance of the sensor, R_P , drops below the programed R_P_MIN , the sensor oscillation may stop. This condition is reported by STATUS:NO_SENSOR_OSC (register 0x20-bit7). This condition could occur when a target comes too close to the sensor or if $RP_SET:RP_MIN$ (register 0x01-bits[2:0]) is set too high.				
DRDYB	6	RP+L Data Ready - reports completion of RP+L conversion results				
RP_HIN	5					
RP_HI_LON	4	DD-1 threehold refer to Commentar Excellencity for details				
L_HIN	3	RP+L threshold – refer to Comparator Functionality for details				
L_HI_LON	2					
POR_READ	0	Device in Power-On Reset – device should only be configured when POR_READ = 0.				

Table 2. STATUS Fields

The LHR_STATUS register (register 0x3B) reports on LHR functionality.

8.4.9 Switch Functionality and INTB Reporting

The SDO pin can generate INTB, a signal which corresponds to device status. INTB can report conversion completion or provide a comparator output, in which the LDC conversion results are internally compared to programmable thresholds. Refer to *INTB Reporting on SDO* for details.


8.5 Programming

8.5.1 SPI Programming

The LDC1101 uses SPI to configure the internal registers. It is necessary to configure the LDC1101 while in Sleep mode. If a setting on the LDC1101 needs to be changed, return the device to Sleep mode, change the appropriate register, and then return the LDC1101 to conversion mode. CSB must go low before accessing first address. If the number of SCLK pulses is less than 16, a register write command will not change the contents of the addressed register.



Programming (continued)

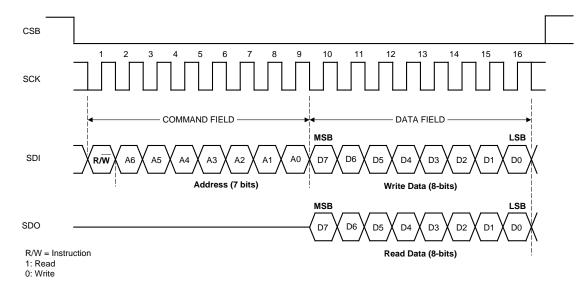



The LDC1101 supports an extended SPI transaction, in which CSB is held low and sequential register addresses can be written or read. After the first register transaction, each additional 8 SCLK pulses will address the next register, reading or writing based on the initial R/W flag in the initial command. A register write command will take effect on the 8th clock pulse. Two or more registers can be programmed using this method. The register address must not increment above 0x3F.

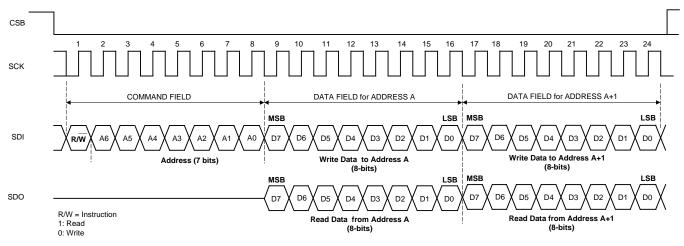


Figure 13. Extended SPI Transaction

TEXAS INSTRUMENTS

www.ti.com.cn

8.6 Register Maps

Table 3. Register List

ADDRESS	NAME	DEFAULT VALUE	DESCRIPTION		
0x01	RP_SET	0x07	Configure R _P Measurement Dynamic Range		
0x02	TC1	0x90	Configure Internal Time Constant 1		
0x03	TC2	0xA0	Configure Internal Time Constant 2		
0x04	DIG_CONFIG	0x03	Configure RP+L conversion interval		
0x05	ALT_CONFIG	0x00	Configure additional device settings		
0x06	RP_THRESH_H_LSB	0x00	RP_THRESHOLD High Setting – bits 7:0. This register can be modified while the LDC1101 is in active mode.		
0x07	RP_THRESH_H_MSB	0x00	RP_THRESHOLD High Setting – bits 15:8. This register can be modified while the LDC1101 is in active mode.		
0x08	RP_THRESH_L_LSB	0x00	RP_THRESHOLD Low Setting – bits 7:0. This register can be modified while the LDC1101 is in active mode.		
0x09	RP_THRESH_L_MSB	0x00	RP_THRESHOLD Low Setting – bits 15:8. This register can be modified while the LDC1101 is in active mode.		
0x0A	INTB_MODE	0x00	Configure INTB reporting on SDO pin. This register can be modified while the LDC1101 is in active mode.		
0x0B	START_CONFIG	0x01	Configure Power State		
0x0C	D_CONF	0x00	Sensor Amplitude Control Requirement		
0x16	L_THRESH_HI_LSB	0x00	L_THRESHOLD High Setting – bits 7:0. This register can be modified while the LDC1101 is in active mode.		
0x17	L_THRESH_HI_MSB	0x00	L_THRESHOLD High Setting – bits 15:8. This register can be modified while the LDC1101 is in active mode.		
0x18	L_THRESH_LO_LSB	0x00	L_THRESHOLD Low Setting – bits 7:0. This register can be modified while the LDC1101 is in active mode.		
0x19	L_THRESH_LO_MSB	0x00	L_THRESHOLD Low Setting – bits 15:8. This register can be modified while the LDC1101 is in active mode.		
0x20	STATUS	0x00	Report RP+L measurement status		
0x21	RP_DATA_LSB	0x00	R _P Conversion Result Data Output - bits 7:0		
0x22	RP_DATA_MSB	0x00	R _P Conversion Result Data Output - bits 15:8		
0x23	L_DATA_LSB	0x00	L Conversion Result Data Output - bits 7:0		
0x24	L_DATA_MSB	0x00	L Conversion Result Data Output - bits 15:8		
0x30	LHR_RCOUNT_LSB	0x00	High Resolution L Reference Count – bits 7:0		
0x31	LHR_RCOUNT_MSB	0x00	High Resolution L Reference Count – bits 15:8		
0x32	LHR_OFFSET_LSB	0x00	High Resolution L Offset – bits 7:0		
0x33	LHR_OFFSET_MSB	0x00	High Resolution L Offset – bits 15:8		
0x34	LHR_CONFIG	0x00	High Resolution L Configuration		
0x38	LHR_DATA_LSB	0x00	High Resolution L Conversion Result Data output - bits 7:0		
0x39	LHR_DATA_MID	0x00	High Resolution L Conversion Result Data output - bits 15:8		
0x3A	LHR_DATA_MSB	0x00	High Resolution L Conversion Result Data output - bits 23:16		
0x3B	LHR_STATUS	0x00	High Resolution L Measurement Status		
0x3E	RID	0x02	Device RID value		
0x3F	CHIP_ID	0xD4	Device ID value		



8.6.1 Individual Register Listings

Fields indicated with Reserved must be written only with indicated values. Improper device operation may occur otherwise. The R/W column indicates the Read-Write status of the corresponding field. A 'R/W' entry indicates read and write capability, a 'R' indicates read-only, and a 'W' indicates write-only.

8.6.2 Register RP_SET (address = 0x01) [reset = 0x07]

Figure 14. Register RP_SET

7	6	5	4	3	2	1	0
RPMAX_DIS		RP_MAX		RESERVED		RP_MIN	
R/W		R/W		R/W		R/W	

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 4. Register RP_SET Field Descriptions

Bit	Field	Туре	Reset	Description
7	RPMAX_DIS	R/W		RP_MAX Disable
				This setting improves the $R_{\rm P}$ measurement accuracy for very high Q coils by driving 0A as the $R_{\rm PMAX}$ current drive.
				b0: Programmed RP_MAX is driven (default value) b1: RP_MAX current is ignored; current drive is off.
6:4	RP_MAX	R/W		RP_MAX Setting
				Set the maximum input dynamic range for the sensor R_P measurement. The programmed RP_MIN setting must not exceed the programmed RP_MAX setting. b000: RPMAX = 96 k Ω (default value) b001: RPMAX = 48 k Ω b010: RPMAX = 24 k Ω b010: RPMAX = 24 k Ω b011: RPMAX = 12 k Ω b100: RPMAX = 6 k Ω b101: RPMAX = 3 k Ω b110: RPMAX = 1.5 k Ω b111: RPMAX = 0.75 k Ω
3	RESERVED	R/W		Reserved. Set to 0
2:0	RP_MIN	R/W		RP_MIN Setting
				Set the minimum input dynamic range for the sensor R_P measurement. The programmed RP_MIN setting must not exceed the programmed RP_MAX setting. b000: RPMIN = 96 k Ω b001: RPMIN = 48 k Ω b010: RPMIN = 24 k Ω b011: RPMIN = 12 k Ω b100: RPMIN = 12 k Ω b100: RPMIN = 6 k Ω b101: RPMIN = 3 k Ω b110: RPMIN = 1.5 k Ω b111: RPMIN = 0.75 k Ω (default value)

8.6.3 Register TC1 (address = 0x02) [reset = 0x90]

www.ti.com.cn

Figure 15. Register TC1

7	6	5	4	3	2	1	0
	C1	RESERVED			R1		
F	R/W	R/W			R/W		

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 5. Register TC1 Field Descriptions

Bit	Field	Туре	Reset	Description
7:6	C1	R/W		Internal Time Constant 1 Capacitance
				This sets the capacitive component used to configure internal time constant 1. Refer to Setting Internal Time Constant 1 for more details. b00: C1 = 0.75 pF b01: C1 = 1.5 pF b10: C1 = 3.0 pF (default value) b11: C1 = 6.0 pF
5	RESERVED	R/W		Reserved. Set to 0
4:0	R1	R/W		Internal Time Constant 1 Resistance
				This sets the resistive component used to configure internal time constant 1. Refer to Setting Internal Time Constant 1 for configuration details.
				R1(Ω) = -12.77 kΩ × R1 + 417 kΩ
				Valid Values: [b0'000:b1'1111] b0'0000: $R_1 = 417 \ k\Omega$ b1'0000: $R_1 = 212.7 \ k\Omega$ (default value) b1'1111: $R_1 = 21.1 \ k\Omega$

8.6.4 Register TC2 (address = 0x03) [reset = 0xA0]

Figure 16. Register TC2

7	6	5	4	3	2	1	0
C2		R2					
	R/W			R/	W		

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 6. Register TC2 Field Descriptions

Bit	Field	Туре	Reset	Description
7:6	C2	R/W		Internal Time Constant 2 Capacitance
				This sets the capacitive component used to configure internal time constant 2. Refer to Setting Internal Time Constant 2 for configuration details. b00: C2 = 3 pF b01: C2 = 6 pF b10: C2 = 12 pF (default value) b11: C2 = 24 pF
5:0	R2	R/W		Internal Time Constant 2 Resistance
				This sets the resistive component used to configure internal time constant 2. Refer to Setting Internal Time Constant 2 for details. $R_2(\Omega) = -12.77 k\Omega \times R2 + 835 k\Omega$ Valid Values: [b00'0000:b11'1111] b00'0000: $R_2 = 835k\Omega$ b10'0000: $R_2 = 426.4 k\Omega$ (default value) b11'1111: $R_2 = 30.5 k\Omega$

8.6.5 Register DIG_CONF (address = 0x04) [reset = 0x03]

Figure 17. Register DIG_CONF

7	6	5	4	3	2	1	0	
	MIN_I	FREQ		RESERVED	RESP_TIME			
	R/W							

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 7. Register DIG_CONF Field Descriptions

Bit	Field	Туре	Reset	Description
7:4	MIN_FREQ	R/W		Sensor Minimum Frequency
				Configure this register based on the lowest possible sensor frequency. This is typically when the target is providing minimum interaction with the sensor, although with some steel and ferrite targets, the minimum sensor frequency occurs with maximum target interaction.
				This setting should include any additional effects which reduce the sensor frequency, including temperature shifts and sensor capacitor variation.
				$MIN_FREQ = 16 - (8 MHz \div f_{SENSORMIN})$
				b0000: f _{SENSORMIN} = 500 kHz (default value) b1111: f _{SENSORMIN} = 8 MHz
3	RESERVED	R/W		Reserved. Set to 0
2:0	RESP_TIME	R/W		Measurement Response Time Setting
				Sets the Response Time, which is the number of sensor periods used per conversion. This setting applies to the R _P and Standard Resolution L measurement, but not the High Resolution L measurement. This corresponds to the actual conversion time by: Conversion Time (s) = $\frac{\text{Re sponse Time}}{3 \times f_{\text{SENSOR}}}$
				b000: Reserved (do not use) b001: Reserved (do not use) b010: Reserved Time 102
				b010: Response Time = 192 b011: Response Time = 384 (default value)
				b100: Response Time = 768
				b101: Response Time = 1536
				b110: Response Time = 3072
				b111: Response Time = 6144

8.6.6 Register ALT_CONFIG (address = 0x05) [reset = 0x00]

Figure 18. Register ALT_CONFIG

7	6	5	4	3	2	1	0
	RESERVED					SHUTDOWN_EN	LOPTIMAL
	R/W					R/W	R/W

Bit	Field	Туре	Reset	Description
7:2	RESERVED	R/W		Reserved. Set to b00'0000.
1	SHUTDOWN_EN	R/W		Shutdown Enable
				Enables shutdown mode of operation. If SHUTDOWN_EN is not set to 1, then SHUTDOWN (Address 0x0B:[1]) will not have any effect. b0: Shutdown not enabled. (default value) b1: Shutdown functionality enabled.



Bit	Field	Туре	Reset	Description
0	LOPTIMAL	R/W		Optimize for L Measurements
				Optimize sensor drive signal for L measurements (for both High-Res L and L measurement). When LOPTIMAL is enabled, R _P measurements will not be completed. It is also necessary to set DOK_REPORT=1 when this mode is enabled. b0: L optimal disabled; both RP+L/LHR measurements (default value) b1: Only perform LHR and/or L-only measurements. R _P measurements are invalid.

Table 8. Register ALT_CONFIG Field Descriptions (continued)

8.6.7 Register RP_THRESH_HI_LSB (address = 0x06) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode.

Figure 19. Register RP_THRESH_HI_LSB

7	6	5	4	3	2	1	0		
	RP_THRESH_HI_LSB								
			R	2/W					

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 9. Register RP_THRESH_HI_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	RP_THRESH_HI_LSB	R/W		R _P High Threshold LSB Setting
				Combine with value in Register RP_THRESH_HI_MSB (Address 0x07) to set the upper R_P conversion threshold:
				RP_THRESH_HI = RP_THRESH_HI[15:8] × 256 + RP_THRESH_HI[7:0]
				If RP_DATA conversion result is greater than the RP_THRESH_HI, RP_TH_I will be asserted.
				Note that RP_THRESH_HI_LSB is buffered and will not change the device configuration until a write to RP_TRESH_HI_MSB is performed. Note that both registers 0x06 and 0x07 must be written to change the value of RP_THRESH_HI.
				0x00: default value

8.6.8 Register RP_THRESH_HI_MSB (address = 0x07) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode.

Figure 20. Register RP_THRESH_HI_MSB

7	6	5	4	3	2	1	0	
RP_THRESH_HI_MSB								
	R/W							

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 10. Register RP_THRESH_HI_MSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	RP_THRESH_HI_MSB	R/W		R _P High Threshold MSB Setting
				Combine with value in Register RP_THRESH_HI_LSB (Address 0x06) to set the upper R_P conversion threshold. 0x00: default value



8.6.9 Register RP_THRESH_LO_LSB (address = 0x08) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode.

Figure 21. Register RP_THRESH_LO_LSB

7	6	5	4	3	2	1	0	
	RP_THRESH_LO_LSB							
	 R/W							

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 11. Register RP_THRESH_LO_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	RP_THRESH_LO[7:0]	R/W		R _P Low Threshold LSB Setting
				Combine with value in Register RP_THRESH_LO_MSB (Address 0x09) to set the lower R _P conversion threshold: RP_THRESH_LO = RP_THRESH_LO[15:8] ×256 + RP_THRESH_LO[7:0]
				If RP_DATA conversion result is less than the RP_THRESH_LO, RP_HI_LON will be asserted. Note that RP_THRESH_LO_LSB is buffered and will not change the device configuration until a write to RP_TRESH_LO_MSB is performed.
				Note that both registers 0x08 and 0x09 must be written to change the value of RP_THRESH_LO. 0x00: default value

8.6.10 Register RP_THRESH_LO_MSB (address = 0x09) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode

Figure 22. Register RP_THRESH_LO_MSB

7	6	5	4	3	2	1	0	
	RP_THRESH_LO_MSB							
	R/W							

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 12. Register RP_THRESH_LO_MSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	RP_THRESH_LO_MSB[1	R/W		R _P Low Threshold MSB Setting
	5:8]			Combine with value in Register RP_THRESH_LO_LSB (Address 0x08) to set the lower R_P conversion threshold. 0x00: default value

8.6.11 Register INTB_MODE (address = 0x0A) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode.

Figure 23. Register INTB_MODE

7	6	5	4	3	2	1	0
INTB2SDO	RESERVED			INTB_	FUNC		
R/W	R/W			R/	W		

Ų	Texas Instruments
Y	

Bit	Field	Туре	Reset	Description
7	INTB2SDO	R/W		INTB Output on SDO
				Output INTB signal on SDO pin. b0: do not report DRDY on SDO pin (default value) b1: report DRDY on SDO pin
6	RESERVED	R/W		Reserved. Set to 0
5:0	INTB_FUNC	R/W		Select INTB signal reporting. INTB2SDO must be set to 1 for the selected signal to appear on the SDO pin. Refer to <i>INTB Reporting on SDO</i> for configuration details.
				b10'0000: Report LHR Data Ready b01'0000: Compare L conversion to L Thresholds (hysteresis) b00'1000: Compare L conversion to L High Threshold (latching) b00'0100: Report RP+L Data Ready
				b00'0010: Compare R _P conversion to R _P Thresholds (hysteresis) b00'0001: Compare R _P conversion to R _P High Threshold (latching) b00'0000: no output (default value) All other values: Reserved

Table 13. NAME Field Descriptions

8.6.12 9.Register START_CONFIG (address = 0x0B) [reset = 0x01]

This register can be modified while the LDC1101 is in active mode.

Figure 24. Register START_CONFIG

7	6	5	4	3	2	1	0
	RESERVED					FUNC	_MODE
	R/W					R	/W
-							

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 14. Register START_CONFIG Field Descriptions

Bit	Field	Туре	Reset	Description
7:2	RESERVED	R/W		Reserved. Set to b00'0000
1:0	FUNC_MODE	R/W		Functional Mode
				Configure functional mode of device. In active mode, the device performs conversions. When in Sleep mode, the LDC1101 is in a reduced power mode; the device should be configured in this mode. Shutdown mode is a minimal current mode in which the device configuration is not retained.
				Note that SHUTDOWN_EN must be set to 1 prior to setting FUNC_MODE to b10. b00: Active conversion mode b01: Sleep mode (default value) b10: Set device to shutdown mode b11: Reserved

8.6.13 Register D_CONFIG (address = 0x0C) [reset = 0x00]

Figure 25. Register D_CONFIG

7	6	5	4	3	2	1	0	
	RESERVED							
	R/W							
							R/W	



Bit	Field	Туре	Reset	Description				
7:1	RESERVED	R/W		Reserved. Set to b000'0000.				
0	DOK_REPORT	R/W		Sensor Amplitude Control Continue to convert even if sensor amplitude is not regulated. b0: Require amplitude regulation for conversion (default value)				
				b1: LDC will continue to convert even if sensor amplitude is unable to maintain regulation.				

Table 15. Register D_CONFIG Field Descriptions

8.6.14 Register L_THRESH_HI_LSB (address = 0x16) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode.

Figure 26. Register L_THRESH_HI_LSB

7	6	5	4	3	2	1	0
			L_THRE	SH_HI[7:0]			
			R	2/W			

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 16. Register L_THRESH_HI_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	L_THRESH_HI[7:0]	R/W		L High Threshold LSB Setting
				Combine with value in Register L_THRESH_HI_MSB (Address 0x17) to set the upper L conversion threshold:
				L _{ThreshHI} = L_THRESH_HI[15:8] ×256 + L_THRESH_HI[7:0]
				If L_DATA conversion result is greater than the L_THRESH_HI, L_HIN will be asserted. Note that L_THRESH_HI_LSB is buffered and will not change the device configuration until a write to L_TRESH_HI_MSB. 0x00: default value

8.6.15 Register L_THRESH_HI_MSB (address = 0x17) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode.

Figure 27. Register L_THRESH_HI_MSB

7	6	5	4	3	2	1	0
			L_THRES	H_HI[15:8]			
			R				

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 17. Register L_THRESH_HI_MSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	L_THRESH_HI[15:8]	R/W		L High Threshold MSB Setting
				Combine with value in Register L_THRESH_HI_LSB (Address 0x16) to set the upper L conversion threshold. 0x00: default value

8.6.16 Register L_THRESH_LO_LSB (address = 0x18) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode.

ZHCSDS7A - MAY 2015 - REVISED JUNE 2015

LDC1101

www.ti.com.cn

RUMENTS

Figure 28. Register L_THRESH_LO_LSB

7	6	5	4	3	2	1	0
			L_THRE	SH_L[7:0]			
			R	R/W			

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 18. Register L_THRESH_LO_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	L_THRESH_LO[7:0]	R/W		L Low Threshold LSB Setting
				Combine with value in Register L_THRESH_LO_MSB (Address 0x19) to set the lower L conversion threshold:
				L _{ThreshLO} = L_THRESH_LO[15:8] ×256 + L_THRESH_LO[7:0]
				If L_DATA conversion result is less than the L_THRESH_LO, L_HI_LON will be asserted.
				Note that L_THRESH_LO_LSB is buffered and will not change the device configuration until a write to L_TRESH_LO_MSB. 0x00: default value

8.6.17 Register L_THRESH_LO_MSB (address = 0x19) [reset = 0x00]

This register can be modified while the LDC1101 is in active mode.

Figure 29. L_THRESH_LO_MSB

7	6	5	4	3	2	1	0
			L_THRES	SH_L[15:8]			
			R	/W			

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 19. L_THRESH_LO_MSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	L_THRESH_LO[15:8]	R/W		L Low Threshold MSB Setting
				Combine with value in Register L_THRESH_LO_LSB (Address 0x18) to set the lower L conversion threshold. 0x00: default value

8.6.18 Register STATUS (address = 0x020 [reset = 0x00]

Figure 30. Register STATUS

7	6	5	4	3	2	1	0
NO_SENSOR_OSC	DRDYB	RP_HIN	RP_HI_LON	L_HIN	L_HI_LON	RESERVED	POR_READ
R	R	R	R	R	R	R	R

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 20. Register STATUS Field Descriptions

Bit	Field	Туре	Reset	Description
7	NO_SENSOR_OSC	R		Sensor Oscillation Not Present Error
				Indicates that the sensor has stopped oscillating. This error may also be produced if the MIN_FREQ is set to too high a value. b0: Error condition has not occurred b1: LDC1101 has not detected the sensor oscillation.
6	DRDYB	R		RP+L Data Ready b0: New RP+L conversion data is available. b1: No new conversion data is available.



LDC1101 ZHCSDS7A – MAY 2015 – REVISED JUNE 2015

www.ti.com.cn

 Table 20. Register STATUS Field Descriptions (continued)

Bit	Field	Туре	Reset	Description
5	RP_HIN	R		RP_DATA High Threshold Comparator
				Note this field will latch a low value. To clear, write 0x00 to register 0x0A. INTB_FUNC (register 0x0A:bits[5:0]) must be set to b00'0001 for this flag to be reported. b0: RP_DATA measurement has exceeded RP_THRESH_HI b1: RP_DATA measurement has not exceeded RP_THRESH_HI
4	RP_HI_LON	R		RP_DATA Hysteresis Comparator b0: RP_DATA measurement has gone above RP_THRESH_LO. b1: RP_DATA measurement has gone below RP_THRESH_HI.
3	L_HIN	R		L_DATA High Threshold Comparator
				Note this field will latch a low value. To clear, write 0x00 to register 0x0A. INTB_FUNC (register 0x0A:bits[5:0]) must be set to b00'1000 for this flag to be reported. b0: L_DATA measurement has exceeded L_THRESH_HI b1: L_DATA measurement has not exceeded L_THRESH_HI
2	L_HI_LON	R		L_DATA Hysteresis Comparator b0: L_DATA measurement has gone above L_THRESH_LO. b1: L_DATA measurement has gone below L_THRESH_HI.
1	RESERVED	R		No Function 0: default value
0	POR_READ	R		Device in Power-On-Reset
				Indicates the device is in process of resetting. Note that the device cannot accept any configuration changes until reset is complete. Wait until POR_READ = 0 before changing any device configuration. b0: Device is not in reset. b1: Device is currently in reset; wait until POR_READ = 0.

8.6.19 Register RP_DATA_LSB (address = 0x21) [reset = 0x00]

Figure 31. Register RP_DATA_LSB

7	6	5	4	3	2	1	0
			RP_DA	TA[7:0]			
			F	२			

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 21. Register RP_DATA_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	RP_DATA[7:0]	R		RP-Measurement Conversion Result
				Combine with values in Register RP_DATA_MSB (Address 0x22) to determine R_P conversion result:
				RP_DATA = RP_DATA[15:8]×256 + RP_DATA[7:0] NOTE: RP_DATA_LSB (Address 0x21) must be read prior to reading the RP_DATA_MSB (Address 0x22) register to properly retrieve conversion results.

8.6.20 Register RP_DATA_MSB (address = 0x22) [reset = 0x00]

Figure 32. Register RP_DATA_MSB

7	6	5	4	3	2	1	0
			RP_DA	TA[15:8]			
			F	२			

LDC1101 ZHCSDS7A-MAY 2015-REVISED JUNE 2015 IEXAS INSTRUMENTS

www.ti.com.cn

Bit	Field	Туре	Reset	Description
7:0	RP_DATA[15:8]	R		RP-Measurement Conversion Result
				Combine with values in Register RP_DATA_LSB (Address 0x21) to determine R_P conversion result: NOTE: RP_DATA_LSB (Address 0x21) must be read prior to reading this register to properly retrieve conversion results.

Table 22. Register RP_DATA_MSB Field Descriptions

8.6.21 Register L_DATA_LSB (address = 0x23) [reset = 0x00]

Figure 33. Register L_DATA_LSB

7	6	5	4	3	2	1	0
			L_DA1	ΓA[7:0]			
			F	२			

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 23. Register L_DATA_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	L_DATA[7:0]	R		L-Measurement Conversion Result
				Combine with values in Register L_DATA_MSB (Address 0x24) to determine L conversion result:
				L_DATA = L_DATA[15:8]×256 + L_DATA[7:0]
				$ \begin{array}{l} f_{SENSOR} = (\ f_{CLKIN} \times RESP_TIME) / (3 \times L_DATA) \\ NOTE: \ RP_DATA_LSB \ (Address \ 0x21) \ must \ be \ read \ prior \ to \\ reading \ this \ register \ to \ properly \ retrieve \ conversion \ results. \end{array} $

8.6.22 Register L_DATA_MSB (address = 0x24) [reset = 0x00]

Figure 34. Register L_DATA_MSB

7	6	5	4	3	2	1	0
	L_DATA[15:8]						
	R						

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 24. Register L_DATA_MSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	L_DATA[15:8]	R		L-Measurement Conversion Result
				Combine with values in Register L_DATA_LSB (Address 0x23) to determine L conversion result: NOTE: RP_DATA_LSB (Address 0x21) must be read prior to reading this register to properly retrieve conversion results.

8.6.23 Register LHR_RCOUNT_LSB (address = 0x30) [reset = 0x00]

Figure 35. Register LHR_RCOUNT_LSB

7	6	5	4	3	2	1	0
	RCOUNT[7:0]						
			R/	W			



Table 25. Register LHR_RCOUNT_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	RCOUNT[7:0]	R	C	High Resolution L-Measurement Reference Count Setting Combine with value in Register LHR_RCOUNT_MSB (Address 0x31) to set the measurement time for High Resolution L
				Measurements. 0x00: default value

8.6.24 Register LHR_RCOUNT_MSB (address = 0x31) [reset = 0x00]

Figure 36. Register LHR_RCOUNT_MSB

7	6	5	4	3	2	1	0	
	RCOUNT[15:8]							
		R/W						

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 26. Register LHR_RCOUNT_MSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	RCOUNT[15:8]			High Resolution L-Measurement Reference Count Setting
				Combine with value in Register LHR_RCOUNT_LSB (Address 0x30) to set the measurement time for High Resolution L Measurements.
				Higher values for LHR_RCOUNT have a higher effective measurement resolution but a lower sample rate. Refer to LHR Sample Rate Configuration with RCOUNT for more details.
				Measurement Time (t _{CONV})= (RCOUNT[15:0] × 16 + 55)/f _{CLKIN} RCOUNT = RCOUNT [15:8]×256 + RCOUNT [7:0]
				Valid range: 2 ≤ RCOUNT[15:8] ≤ 65535
				0x00: default value

8.6.25 Register LHR_OFFSET_LSB (address = 0x32) [reset = 0x00]

Figure 37. Register LHR_OFFSET_LSB

7	6	5	4	3	2	1	0
			LHR_OFI	FSET[7:0]			
			R/	W			

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 27. Register LHR_OFFSET_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	LHR_OFFSET[7:0]	R/W		High Resolution L-Measurement Offset Setting
				Combine with value in Register LHR_OFFSET_LSB (Address 0x32) to set the offset value applied to High Resolution L Measurements. 0x00: default value

8.6.26 Register LHR_OFFSET_MSB (address = 0x33) [reset = 0x00]

Figure 38. Register LHR_OFFSET_MSB

7	6	5	4	3	2	1	0
	LHR_OFFSET[15:8]						
			R	/W			

LDC1101 ZHCSDS7A-MAY 2015-REVISED JUNE 2015 Texas Instruments

www.ti.com.cn

Table 28. Register LHR_OFFSET_MSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	LHR_OFFSET[15:8]	R/W		High Resolution L-Measurement Offset Setting
				Combine with value in Register LHR_OFFSET_LSB (Address 0x32) to set the offset value applied to High Resolution L Measurements. 0x00: default value

8.6.27 Register LHR_CONFIG (address = 0x34) [reset = 0x00]

Figure 39. Register LHR_CONFIG

7	6 5 4 3 2						0
		RESE		SENSO	DR_DIV		
	R/W					R	/W

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 29. Register LHR_CONFIG Field Descriptions

Bit	Field	Туре	Reset	Description
7:2	RESERVED	R/W		Reserved. Set to b00'0000
1:0	SENSOR_DIV	R/W		Sensor Clock Divider Setting
				Divide the sensor frequency by programmed divider. This divider can be used to set the sensor frequency lower than the reference frequency. Refer to <i>Sensor Input Divider</i> for more details. b00: Sensor Frequency not divided (default value) b01: Sensor Frequency divided by 2 b10: Sensor Frequency divided by 4 b11: Sensor Frequency divided by 8

8.6.28 Register LHR_DATA_LSB (address = 0x38) [reset = 0x00]

Figure 40. Register LHR_DATA_LSB

7	6	5	4	3	2	1	0
LHR_DATA[7:0]							
	R						

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 30. Register LHR_DATA_LSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	LHR_DATA[7:0]	R		High Resolution L-Measurement Conversion Result
				Combine with values in Registers LHR_DATA_MID (Address 0x39) and LHR_DATA_MSB (Address 0x3A) to determine conversion result.
				$f_{SENSOR} = f_{CLKIN} \times SENSOR_DIV \times LHR_DATA \div 2^{24}$
				NOTE: The LHR_DATA registers must be read in the sequence 0x38 first, then 0x39, and last 0x3A for data coherency.

8.6.29 Register LHR_DATA_MID (address = 0x39) [reset = 0x00]

Figure 41. Register LHR_DATA_MID

7	6	5	4	3	2	1	0	
	LHR_DATA[15:8]							
	R							



Table 31. Register LHR_DATA_MID Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	LHR_DATA[15:8]	R		High Resolution L-Measurement Conversion Result
				Combine with values in Registers LHR_DATA_LSB (Address 0x38) and LHR_DATA_MSB (Address 0x3A) to determine conversion result.
				NOTE: Register LDR_DATA_LSB must be read prior to this register and LHR_DATA_MSB to ensure data coherency.

8.6.30 Register LHR_DATA_MSB (address = 0x3A) [reset = 0x00]

Figure 42. Register LHR_DATA_MSB

7	6	5	4	3	2	1	0
			LHR_DA	TA[23:16]			
			F	۲			

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 32. Register LHR_DATA_MSB Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	LHR_DATA[23:16]	R		High Resolution L-Measurement Conversion Result
				Combine with values in Registers LHR_DATA_LSB (Address 0x38) and LHR_DATA_MID (Address 0x39) to determine conversion result. NOTE: Register LDR_DATA_LSB must be read prior to LHR DATA MID and this register to ensure data coherency.

8.6.31 Register LHR_STATUS (address = 0x3B) [reset = 0x00]

Figure 43. Register LHR_STATUS

7	6	5	4	3	2	1	0
	UNUSED		ERR_ZC	ERR_OR	ERR_UR	ERR_OF	LHR_DRDY
	R		R	R	R	R	R

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 33. Register LHR_STATUS Field Descriptions

Bit	Field	Туре	Reset	Description
7:5	UNUSED	R		No Function
4	ERR_ZC	R		 Zero Count Error Zero count errors are applicable for LHR measurements and indicate that no cycles of the sensor occurred in the programmed measurement interval. This indicates either a sensor error or the sensor frequency is too low. This field is updated after register 0x38 has been read. b0: No Zero Count error has occurred for the last LHR conversion result read. b1: A Zero Count error has occurred.
3	ERR_OR	R		 Conversion Over-range Error Conversion over-range errors are applicable for LHR measurements and indicate that the sensor frequency exceeded the reference frequency. This field is updated after register 0x38 has been read. b0: No Conversion Over-range error has occurred for the last LHR conversion result read. b1: A Conversion Over-range error has occurred.

LDC1101 ZHCSDS7A-MAY 2015-REVISED JUNE 2015

www.ti.com.cn

STRUMENTS

XAS

Bit	Field	Туре	Reset	Description
2	ERR_UR	R		Conversion Under-range Error
				Conversion under-range errors are applicable for LHR measurements and indicate that the output code is negative; this occurs when programmed LHR offset register value is too large. This field is updated after register 0x38 has been read. b0: No Conversion Under-range error has occurred for the last LHR conversion result read. b1: A Conversion Under-range error has occurred.
1	ERR_OF	R		Conversion Over-flow Error
				Conversion over-flow errors are applicable for LHR measurements and indicate that the sensor frequency is too close to the reference frequency. This field is updated after register 0x38 has been read. b0 : No Conversion Over-flow error has occurred for the last LHR conversion result read. b1 : A Conversion Over-flow error has occurred.
0	LHR_DRDY	R		LHR Data Ready
				 b0: Unread LHR conversion data is available. This field is set to 0 at the end of an LHR conversion and remains asserted until a read of register 0x38. b1: No unread LHR conversion data is available.

Table 33. Register LHR_STATUS Field Descriptions (continued)

8.6.32 Register RID (address = 0x3E) [reset = 0x02]

Figure 44. Register RID

7	6	5	4	3	2	1	0
		V_ID				RID	
	R					R	

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 34. Register RID Field Descriptions

Bit	Field	Туре	Reset	Description
7:3	V_ID	R		DEVICE ID
				Returns fixed value indicating device ID. 0x00: indicates LDC1101 (default value)
2:0	RID	R		RID
				Returns device RID. b010: Default value

8.6.33 Register DEVICE_ID (address = 0x3F) [reset = 0xD4]

Figure 45. Register DEVICE_ID

7	6	5	4	3	2	1	0
			CHI	P_ID			
			F	२			

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 35. Register DEVICE_ID Field Descriptions

Bit	Field	Туре	Reset	Description
7:0	CHIP_ID	R		CHIP_ID
				Returns fixed value indicating device Family ID. 0xD4: indicates LDC1101 family (default value)



9 Application and Implementation

NOTE

Information in the following applications sections is not part of the TI component specification, and TI does not warrant its accuracy or completeness. TI's customers are responsible for determining suitability of components for their purposes. Customers should validate and test their design implementation to confirm system functionality.

9.1 Application Information

9.1.1 Theory of Operation

An AC current flowing through an inductor will generate an AC magnetic field. If a conductive material, such as a metal object, is brought into the vicinity of the inductor, the magnetic field will induce a circulating current (eddy current) on the surface of the conductor. The eddy current is a function of the distance, size, and composition of the conductor.




Figure 46. Conductor in an AC Magnetic Field

The eddy current generates its own magnetic field, which opposes the original field generated by the inductor. This effect can be considered as a set of coupled inductors, where the inductor is the primary winding and the eddy current in the conductor represents the secondary winding. The coupling between the windings is a function of the inductor, and the resistivity, distance, size, and shape of the conductor.

To minimize the current required to drive the inductor, a parallel capacitor is added to create a resonant circuit, which will oscillate at a frequency given by Equation 1 when energy is injected into the circuit. In this way, the LDC1101 only needs to compensate for the parasitic losses in the sensor, represented by the series resistance R_S of the LC tank. The oscillator is then restricted to operating at the resonant frequency of the LC circuit and injects sufficient energy to compensate for the loss from R_S .




Figure 47. LC Tank

The resistance and inductance of the secondary winding caused by the eddy current can be modeled as a distant dependent resistive and inductive component on the primary side (coil). We can then represent the circuit as an equivalent parallel circuit, as shown in Figure 48.




Figure 48. Equivalent Parallel Circuit

The value of R_P can be calculated with:

Application Information (continued)

$$R_P = \frac{L}{R_sC}$$

where

• R_S is the AC series resistance at the frequency of operation.

- C is the parallel capacitance
- L is the inductance

 R_P can be viewed as the load on the sensor driver; this load corresponds to the current drive needed to maintain the oscillation amplitude. The position of a target can change R_P by a significant amount, as shown in Figure 49. The value of R_P can then be used to determine the position of a conductive target. If the value of R_P is too low, then the sensor driver will not be able to maintain sufficient oscillation amplitude.

R_P (kΩ) 10 8 6 4 2 0 0.2 0 0.1 0.3 0.4 0.5 0.6 Target Distance / Sensor Diameter D010

Figure 49. R_P vs Target Distance for a 14 mm Diameter Sensor

9.1.2 RP+L Mode Calculations

For many systems which use the LDC1101, the actual sensor R_P , sensor frequency, or sensor inductance is not necessary to determine the target position; typically the equation of interest is:

Position_{Target} = $f(RP_DATA)$ or Position_{Target} = $f(L_DATA)$

where

- RP_DATA is the contents of registers 0x21 and 0x22
- L_DATA is the contents of registers 0x23 and 0x24

These Position equations are typically system dependent. For applications where the Sensor R_P in Ω s needs to be calculated, use Equation 4:

$$R_{p} = \frac{RP_{MAX} \times RP_{MIN}}{RP_{MAX} \left(1 - \frac{RPDATA}{2^{16} - 1}\right) + RP_{MIN} \frac{RPDATA}{2^{16} - 1}}$$

where

- RPDATA is the contents of RP_DATA_MSB and RP_DATA_LSB (registers 0x21 and 0x22),
- RP_{MIN} is the value set by RP_MIN in register RP_SET (register 0x01), and
- RP_{MAX} is the value set by RP_MIN in register RP_SET (register 0x01).

For example, with device settings of:

- RP_{MIN} set to 1.5 k Ω , and
- RP_{MAX} set to 12 kΩ.

30

If RPDATA = 0x33F1 (register 0x21 = 0xF1 and register 0x22= 0x33), which is 13297 decimal, then the sensor $R_P = 1.824 \text{ k}\Omega$.





(2)


(3)

(4)



Application Information (continued)

If RPMAX_DIS (Register 0x01-b[7]) is set, then the equation is simply:

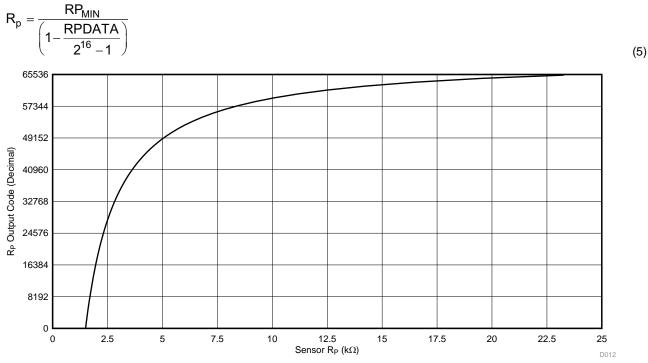



The sensor frequency in Hz can be calculated from Equation 6:

 $f_{SENSOR} = \frac{f_{CLKIN} \times RESP_TIME}{3 \times L_DATA}$

where

- f_{CLKIN} is the frequency input to the CLKIN pin, •
- L_DATA is the contents of registers 0x23 and 0x24, and
- RESP_TIME is the programmed response time in register 0x04.

The inductance in Henrys can then be determined from Equation 7:

$$L_{\text{SENSOR}} = \frac{1}{C_{\text{SENSOR}} \times (2\pi f_{\text{SENSOR}})^2}$$

where

- C_{SENSOR} is the fixed sensor capacitance in Farads, and
- f_{SENSOR} is the measured sensor frequency, as calculated in Equation 6 above. (7)

(6)

Texas Instruments

www.ti.com.cn

Application Information (continued)

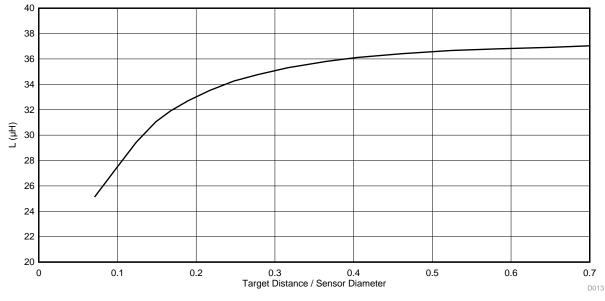


Figure 51. Inductance vs Normalized Target Distance for an Example Sensor

9.1.3 LDC1101 R_P Configuration

Setting the RP_MIN and RP_MAX parameters is necessary for proper operation of the LDC1101; the LDC1101 may not be able to effectively drive the sensor with incorrect settings, as the sensor amplitude will be out of the valid operation region. The LDC1101EVM GUI and the LDC Excel[®] tools spreadsheet (http://www.ti.com/lit/zip/slyc137) can be used to calculate these parameters in an efficient manner.

For R_P measurements, the following register settings must be set as follows:

- ALT_CONFIG.LOPTIMAL(register 0x05-bit0) = 0
- D_CONFIG.DOK_REPORT (register 0x0C-bit0) = 0
- 1. Ensure that the sensor characteristics are within the Sensor boundary conditions:
 - (a) 500 kHz < *f* _{SENSOR} < 10 MHz
 - (b) $100 \text{ pF} < C_{\text{SENSOR}} < 10 \text{ nF}$
 - (c) $1 \mu H < L_{SENSOR} < 500 \mu H$
- Measure the sensor's resonance impedance with minimal target interaction (R_{PD∞}). The minimal target interaction occurs when the target is farthest away from the sensor for axial sensing solutions or when the target coverage of the sensor is at a minimum for rotational or lateral sensing. Select the appropriate setting for RPMAX (register 0x01-bits [5:4]):

 $R_{PD^{\infty}} \leq RPMAX \leq 2R_{PD^{\infty}}$

- 3. Measure the sensor's resonance impedance with the target closest to the sensor (R_{PD0}) as required by the application. Select the largest RPMIN setting that satisfies:
 - (a) RPMIN < $0.8 \times R_{PD0}$
 - (b) If the required RPMIN is smaller than 750 Ω, R_{PD0} must be increased to be compliant with this boundary condition. This can be done by one or more of the following:
 - (a) increasing f_{SENSOR}
 - (b) increasing the minimum distance between the target and the sensor
 - (c) reducing the R_S of the sensor by use of a thicker trace or wire
- 4. Check if the worst-case Sensor quality factor $Q_{MIN}=RpMIN \times \sqrt{(C_{SENSOR}/L_{SENSOR})}$ is within LDC1101's operating range:
 - (a) $10 \le Q_{MIN} \le 400$
 - (b) If $Q_{MIN} < 10$, for a fixed f_{SENSOR} , increase C_{SENSOR} and decrease L_{SENSOR} .
 - (c) If $Q_{MIN} > 400$, for a fixed f_{SENSOR} , decrease C_{SENSOR} and increase L_{SENSOR} .
 - (d) Alternatively the user may choose to not change the current Sensor parameters, but to increase Rp_D0.



Application Information (continued)

If the R_P of the sensor is greater than 75 k Ω , R_P measurement accuracy may be improved by setting RPMAX_DIS to 1.

9.1.4 Setting Internal Time Constant 1

R_P Measurements require configuration of the TC1 and TC2 registers. There are several programmable capacitance and resistance values. Set Time Constant 1 based on minimum sensor frequency:

$$R_1 \times C_1 = \frac{\sqrt{2}}{\pi V_{AMP} f_{SENSOR-MIN}}$$

where

- *f*_{SENSOR-MIN} is the minimum sensor frequency encountered in the system; typically this occurs with no target present.
- V_{AMP} is sensor amplitude of 0.6V,
- R1 is the programmed setting for TC1.R1 (register 0x03-bits[4:0]), and
- C1 is the programmed setting for TC1.C1 (register 0x03-bits[7:6])

(8)

The acceptable range of R1 is from 20.6 k Ω to 417.4 k Ω . If several combinations of R1 and C1 are possible, it is recommended to use the largest capacitance setting for C1 that fits the constraints of Equation 8, as this will provide improved noise performance.

9.1.5 Setting Internal Time Constant 2

Set the Time Constant 2 (register 0x03) using Equation 9:

 $R2 \times C2 = 2 \times RP_MIN \times C_{SENSOR}$

where

- C_{SENSOR} is the parallel capacitance of the sensor.
- RP_MIN is the LDC1101 setting determined in LDC1101 R_P Configuration (for example, use 1.5 kΩ when RP_SET.RP_MIN = b110),
- R2 is the programmed setting for TC2.R2 (register 0x03-bits[5:0]), and
- C2 is the programmed setting for TC2.C2 (register 0x03-bits[7:6]).

(9)

The acceptable range of R2 is from 24.60 k Ω to 834.8 k Ω . If several combinations of R2 and C2 are possible, it is recommended to program the larger capacitance setting for C2 that fits the constraints of Equation 9, as this will provide improved noise performance.

9.1.6 MIN_FREQ and Watchdog Configuration

The LDC1101 includes a watchdog timer which monitors the sensor oscillation. While in active mode, if no sensor oscillation is detected, the LDC1101 will set STATUS.NO_SENSOR_OSC (register 0x20:bit7), and attempt to restart the oscillator. This restart will reset any active conversion.

The watchdog waits an interval of time based on the setting of DIG_CONF.MIN_FREQ (register 0x04:bits[7:4]). The MIN_FREQ setting is also used to configure the startup of oscillation on the sensor. Select the DIG_CONF.MIN_FREQ (register 0x04-bits[7:4]) setting closest to the minimum sensor frequency; this setting is used for internal watchdog timing. If the watchdog determines the sensor has stopped oscillating, it will report the sensor has stopped oscillating in STATUS. NO_SENSOR_OSC (register 0x20-bit7). If the DIG_CONF.MIN_FREQ is set too low, then the LDC1101 will take a longer time interval to report that the sensor oscillation has stopped.

If the DIG_CONF.MIN_FREQ is set too high, then the watchdog may incorrectly report that the sensor has stopped oscillating and attempt to restart the sensor oscillation.

When the watchdog determines that the sensor has stopped oscillating, the LHR conversion results will contain 0xFFFFFF.

34

Application Information (continued)

9.1.7 RP+L Sample Rate Configuration with RESP_TIME

The RP+L sample rate can be adjusted by setting by DIG_CONF.RESP_TIME (register 0x04:bits[2:0]). The Response time can be configured from 192 to 6144 cycles of the sensor frequency. Higher values of Response time will have a slower sample rate, but produce a higher resolution conversion.

Conversion Time(s) =
$$\frac{\text{Re sponse Time}}{3 \times f_{\text{SENSOR}}}$$

(10)

(12)

(13)

(14)

9.1.8 High Resolution Inductance Calculation (LHR mode)

For many systems which use the LDC1101, the actual sensor frequency or sensor inductance is not necessary to determine the target position. Should the sensor frequency in Hz need to be determined, use Equation 11:

$$f_{\text{SENSOR}} = \frac{2^{\text{SENSORDIV}} \times f_{\text{CLKIN}} \left(\text{LHRDATA} + \text{LHROFFSET} \times 2^8 \right)}{2^{24}}$$

where

- LHRDATA is the contents of registers 0x38, 0x39, and 0x3A,
- LHROFFSET is the programmed contents of registers 0x32 and 0x33,
- SENSOR_DIV is the contents of LHR_CONFIG.SENSOR_DIV (register 0x34-bit[1:0]), and
- f_{CLKIN} is the frequency input to the CLKIN pin: ensure that it is within the specified limits of 1 MHz to 16 MHz. (11)

Note that LHR_DATA=0x0000000 indicates a fault condition or that the LDC1101 has never completed an LHR conversion.

The inductance in Henrys can then be determined from the sensor frequency with Equation 12:

L_{SENSOR} =-

 $C_{\text{SENSOR}} \times (2\pi f_{\text{SENSOR}})^2$

1

where

- C_{SENSOR} is the fixed sensor capacitance, and
- f_{SENSOR} is the measured sensor frequency, as calculated above.

Example with the device set to:

• LHR_OFFSET = 0x00FF (register 0x32 = 0xFF, and 0x33 = 0x00)

- $f_{\text{CLKIN}} = 16 \text{ MHz}$
- SENSOR_DIV = b'01 (divide by 2)

and the conversion result is:

LHR_DATA = 0x123456 (register 0x38 = 0x56, register 0x39 = 0x34, register 0x3A = 0x12)

Then entering LHR_DATA = 0x123456 = 1193046 (decimal) into Equation 11:

$$f_{\text{SENSOR}} = \frac{2^1 \times 16 \text{MHz} \left(1193046 + 255 \times 2^8 \right)}{2^{24}}$$

Results in f_{SENSOR} = 2.400066 MHz.

9.1.9 LHR Sample Rate Configuration with RCOUNT

The conversion time represents the number of reference clock cycles used to measure the sensor frequency. The LHR mode conversion time is set by the Reference count in LHR_RCOUNT.RCOUNT (registers 0x30 & 0x31). The LHR conversion time is:

$$t_{\text{CONV}} = \frac{(55 + \text{RCOUNT} \times 16)}{f_{\text{CLKIN}}}$$

Copyright © 2015, Texas Instruments Incorporated



www.ti.com.cn



Application Information (continued)

The 55 is due to post-conversion processing and is a fixed value. The reference count value must be chosen to support the required number of effective bits (ENOB). For example, if an ENOB of 13 bits is required, then a minimum conversion time of $2^{13} = 8192$ clock cycles is required. 8192 clock cycles correspond to a RCOUNT value of 0x0200.

Higher values for RCOUNT produce higher resolution conversions; the maximum setting, 0xFFFF, is required for full resolution.

9.1.10 Setting RPMIN for LHR Measurements

Configure the R_P measurement as shown previously for L measurements. If only L measurements are necessary, then the R_P measurement can be disabled by setting:

- ALT_CONFIG.LOPTIMAL(register 0x05-bit0) = 1
- D_CONFIG.DOK_REPORT (register 0x0C-bit0) = 1

Setting these bits disable the sensor modulation used by the LDC1101 to measure R_P and can reduce L measurement noise. When the R_P modulation is disabled, the LDC1101 will drive a fixed current level into the sensor. The current drive is configured by RP_SET.RPMIN (address 0x01:bits[2:0]). The sensor amplitude must remain between 0.25 Vpk and 1.25 Vpk for accurate L measurements. Use Table 36 to determine the appropriate RPMIN setting, based on the variation in sensor R_P . If multiple RPMIN values cover the Sensor R_P , use the higher current drive setting. The equation to determine sensor amplitude is:

$$\mathsf{R}_{\mathsf{P}} = \frac{\pi \times \mathsf{Vamp}}{4 \times \mathsf{I}_{\mathsf{DRIVE}}}$$

(15)

RPMIN SETTING	RPMIN FIELD VALUE	SENSOR DRIVE (µA)	MINIMUM SENSOR R _P (kΩ)	MAXIMUM SENSOR R _P (kΩ)
0.75 kΩ	b111	600	0.53	1.65
1.5 kΩ	b110	300	1.1	3.3
3 kΩ	b101	150	2.1	6.5
6 kΩ	b100	75	4.2	13.1
12 kΩ	b011	37.5	8.4	26.2
24 kΩ	b010	18.7	16.9	52.4
48 kΩ	b001	9.4	33.9	105
96 kΩ	b000	4.7	67.9	209

Table 36. LHR RPMIN Settings when Sensor R_P Modulation is Disabled

For example, with a sensor that has an R_P which can vary between 2.7 k Ω to 5 k Ω , the appropriate setting for RPMIN would be 3 k Ω (RP_SET.RPMIN = b101). For more information on Sensor R_P and sensor drive, refer to *Configuring Inductive-to-Digital-Converters for Parallel Resistance (RP) Variation in L-C Tank Sensors*(SNAA221).

9.1.11 Sensor Input Divider

The reference clock frequency should be greater than 4 times the sensor frequency for optimum measurement resolution:

$f_{\text{CLKIN}} > 4 f_{\text{SENSOR-MAX}}$

For higher sensor frequencies, this relationship may not be realizable without the sensor divider. Set the sensor divider to an appropriate value to produce an effective reduction in the sensor frequency:

 $f_{\text{CLKIN}} > 4f_{\text{SENSOR-MAX}} \div \text{SENSOR_DIV}$

9.1.12 Reference Clock Input

Use a clean, low jitter, 40-60% duty cycle clock input with an amplitude swing within the range of V_{DD} and GND; proper clock impedance control, and series or parallel termination is recommended. The rise and fall time should be less than 5 ns. Do not use a spread-spectrum or modulated clock.



For optimum L measurement performance, it is recommended to use the highest reference frequency (16 MHz). LHR conversions will not start until a clock is provided on CLKIN.

9.1.13 INTB Reporting on SDO

INTB is a signal generated by the LDC1101 that reports a change in device status. When INTB_MODE.INTB2SDO=1 (register 0x0A:bit7), INTB is multiplexed onto the SDO pin. Once the reporting is enabled, select the desired signal to report by setting INTB_MODE.INTB_FUNC (register 0x0A:bit[5:0]).


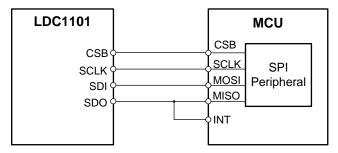


Figure 52. SDO/INTB Connection to MCU

For many microcontrollers, the MISO signal on the SPI peripheral cannot provide the desired interrupt functionality. One method to use the INTB functionality is to connect a second GPIO which triggers on a falling edge, as shown in *Figure 51. Table 37* describes the signal functionality that can be programmed onto INTB.

SIGNAL	INTB_FUNC (0x0A:bit[5:0])	FUNCTIONALITY	SWITCH OUTPUT TYPE
LHR Data Ready (LHR-DRDY)	b10'0000	Indicates new High-Resolution Inductance (LHR) conversion data is available.	Latching
L_HI_LO	b01'0000	L Comparator with hysteresis	Hysteresis
L_TH_HI	b00'1000	Latching L High threshold compare	Latching
RP+L Data Ready (RPL-DRDY)	b00'0100	Indicates new RP+L conversion data is available.	Pulse
RP_HI_LO	b00'0010	R _P Comparator with hysteresis	Hysteresis
RP_TH_HI	b00'0001	Latching R _P High threshold compare	Latching
		No INTB reporting – SDO pin only provides SDO functionality.	N/A



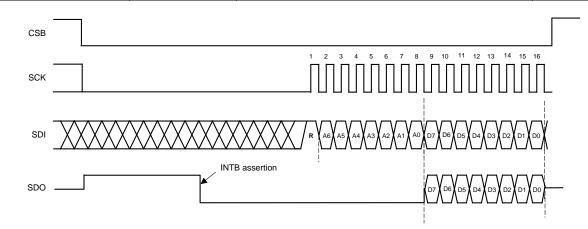

When INTB_MODE.INTB2SDO (register 0x0A:bit7) = 0, the SDO pin is in a Hi-Z state until the 8th falling edge of SCLK after CSB goes low. When INTB reporting is enabled by setting INTB_MODE.INTB2SDO = 1, after CSB goes low, the SDO pin will go high and remain high until:



- the event configured by INTB_MODE.INTB_FUNC occurs,
- an SPI read transaction is initiated, or
- CSB is deasserted (pulled high)

9.1.14 DRDY (Data Ready) Reporting on SDO

Completion of a conversion can be indicated on the SDO pin by reporting the DRDY signal – there is a conversion complete indicator for the RP+L conversion (RPL-DRDY), and a corresponding conversion complete indicator for the LHR mode (LHR-DRDY).

When LHR-DRDY or RPL-DRDY is reported on SDO, the SDO pin is asserted on completion of a conversion. While in this mode, conversion data can be corrupted if a new conversion completes while reading the output data registers. To avoid data corruption, it is important to retrieve the conversion rates via SPI quicker than the shortest conversion interval, and to ensure that the data is retrieved before a new conversion could possibly complete.

When INTB is reporting RPL-DRDY, if CSB is held low for longer than one conversion cycle, INTB will be deasserted approximately 100 ns to 2 μ s prior to the completion of each conversion. The deassertion time is proportional to $1/f_{\text{SENSOR}}$.

When INTB is reporting LHR-DRDY, if CSB is held low for longer than one conversion cycle, INTB will assert on completion of the first conversion and remain low – and it will remain asserted until cleared. To clear the LHR_DRDY signal, read the LHR_DATA registers.

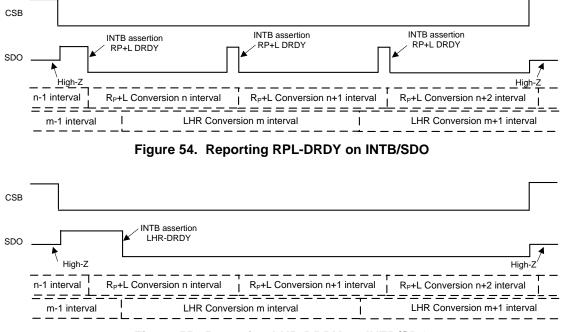


Figure 55. Reporting LHR-DRDY on INTB/SDO

Note that the conversion interval for an LHR measurement is asynchronous to the conversion interval for an R_P+L measurement, therefore the LHR-DRDY signal cannot be used to determine when to read R_P+L conversion results, and vice versa.

9.1.15 Comparator Functionality

The LDC1101 provides comparator functionality, in which the RP+L conversion results can be compared against two thresholds. The results of each R_P and L conversion can be compared against programmable thresholds and reported in the STATUS register. Note that the LHR conversion results cannot be used for comparator functionality.

Copyright © 2015, Texas Instruments Incorporated



In addition, the INTB signal can be asserted or deasserted when the conversion results increase above a Threshold High or decreases below a Threshold Low registers. In this mode, the LDC1101 essentially behaves as a proximity switch with programmable hysteresis. The threshold HI settings must be programmed to a higher value than the threshold LO registers (for example, if RP_THRESH_LO is set to 0x2000, RP_THRESH_HI should programmed to 0x2001 or higher).


Either Latching and non-latching functions can be reported on INTB/SDO. The INTB signal can report a latching signal or a continuous comparison for each conversion result.

The Threshold setting registers (address 0x06:0x09 and 0x16:0x19) can be changed while the LDC1101 is in active conversion mode. It is recommended to change the register values using an extended SPI transaction as described in *SPI Programming*, so that the register updates can be completed in a shorter time interval. This functionality enables the LDC1101 to operate as a dynamic tracking switch. LDC1101 output codes can be readout in < 4 μ s, and the set of active thresholds can be updated in <6 μ s. It is not recommended to update the threshold registers more often than once per conversion interval of the LDC1101 (that is, do not change the threshold register values multiple times in a single conversion interval).

To clear a latched INTB signal, set INTB_MODE = 0x80; it is not necessary for the LDC1101 to be in Sleep mode to clear the latched output; the INTB_MODE can be changed while the LDC1101 is in active mode. After clearing the latched output, re-enabling the INTB_FUNC can be done while in active mode.

FUNCTION	THRESHOLD HIGH	THRESHOLD LOW	STATUS REPORTING	INTB/SDO REPORTING
R _P Comparator with hysteresis	RP_THRESH_HI (registers 0x06 & 0x07)	RP_THRESH_LO (registers 0x08 & 0x09)	RP_HI_LON (bit 4)	RP_HI_LO (INTB_MODE:INTB_FUNC=b00'0010)
R _P High threshold only (Latching)	RP_THRESH_HI (registers 0x06 & 0x07)	N/A	RP_HIN (bit 5)	RP_TH_HI (INTB_MODE:INTB_FUNC=b00'0001) Note that INTB/SDO will latch.
L Comparator with hysteresis	L_THRESH_HI (registers 0x16 & 0x17)	L_THRESH_LO (registers 0x18 & 0x19)	L_HI_LON (bit 2)	L_HI_LO (INTB_MODE:INTB_FUNC=b01'0000)
L High threshold compare only (Latching)	L_THRESH_HI (registers 0x18 & 0x19)	N/A	L_HIN (bit 3)	L_TH_HI (INTB_MODE:INTB_FUNC=b00'1000) Note that INTB/SDO will latch.

Table 38. Comparator Options

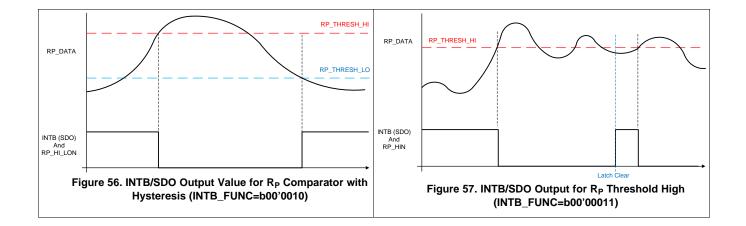



9.2 Typical Application

Implementation of a system using the LDC1101 first requires determining the appropriate measurement to perform. Refer to http://e2e.ti.com/blogs_/b/analogwire/archive/2015/02/11/inductive-sensing-should-i-measure-l-rp-or-both for guidance.

For systems that require measurement of R_P , set the following:

- Configure R_P settings as instructed in LDC1101 R_P Configuration.
- Set the internal time constants as detailed in Setting Internal Time Constant 1 and Setting Internal Time Constant 2.

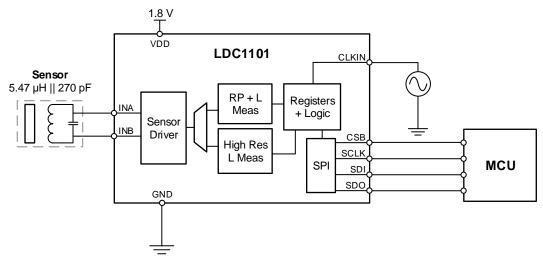


Figure 58. Example LDC1101 Typical Application

9.2.1 Design Requirements

Example of an axial measurement implementation using the LDC1101. In this example, the sensor is an inductor constructed of a multi-layer PCB coil in parallel with a COG grade surface mount capacitor. For this example, a 10 mm diameter Aluminum target of 1mm thickness is moved perpendicular to the plane of the sensor coil.

For this example, the target range of motion is from 1 mm to 3 mm distance from the sensor coil. The position of the target needs to be reported at a sample rate of 3 ksps. The PCB is a 4-layer construction with 0.1 mm (4 mils) minimum feature size.

9.2.2 Detailed Design Procedure

9.2.2.1 Device Configuration for R_P+L Measurement with an Example Sensor

The sensor described in Table 39 meets the restrictions on size on construction. To use it for R_P+L measurement of a 10 mm diameter 1 mm thick Aluminum target moving axially with respect to the sensor:

Table 39. Example Sensor Character	stics
------------------------------------	-------

PARAMETER	MINIMUM TARGET INTERACTION	STRONGEST TARGET INTERACTION					
Inductance	5.47 µH	5.15 µH					
Inductor Outer Diameter	10 mm						
Number of Turns	17						
Trace Spacing/ Trace Width	0.1 mm / 0.16 mm						
Number of Layers/Separation	2 / 0.355 mm						
Sensor Capacitance	270 p	F					
Sensor Frequency	4.11 MHz	4.27 MHz					
R _S	3.20 Ω at 2.93 MHz	3.23 Ω at 4.27 MHz					
R _P	6.33 kΩ at 2.93 MHz	5.91 kΩ at 4.27 MHz					
Q at 2.9 MHz	45	42					

This sensor is within the LDC1101 sensor boundary conditions for frequency, Q, and R_P . The first step is to determine the appropriate RPMIN/RPMAX and TC1/2 settings.

1. Setting RPMAX has the constraint of $R_{PD^{\infty}} \leq RpMAX \leq 2R_{PD^{\infty}}$

6.11 k $\Omega \leq \text{RPMAX} \leq 12.22 \text{ k}\Omega \rightarrow \text{Set RPMAX}$ to 12 k Ω

2. RPMIN setting using the constraint of RpMIN < 0.8 × R_{PD0} :

 $0.8 \times 3.20 \text{ k}\Omega = 2.6 \text{ k}\Omega \rightarrow \text{Set RPMIN to } 1.5 \text{ k}\Omega$. Therefore, set RPMIN = 1.5 k Ω .

- 3. Q Range: In step 4, the sensor Q range of 42 to 45 is within the operating range of 10 to 400. As the sensor Q value is below 50, it is not necessary to use RPMAX_DIS, and so RPMAX_DIS=0.
- 4. Now set the Time Constant 1 using Equation 8:

R1 x C1 = $0.75026 \div 4.11$ MHz = 1.8255E-7sStarting with the largest C1 value of 6 pF for best noise performance results in R1 = $30.5 \text{ k}\Omega$. This is within the R1 range of $20.6 \text{ k}\Omega$ to $417.4 \text{ k}\Omega$, and so C1 = 6 pF can be used. Picking the next higher programmable value for R1 \rightarrow Set R1 = $33.9 \text{ k}\Omega$.

5. Next, set the Time Constant 2 using Equation 9:

 $R2 \times C2 = 2 \times 1.5 \text{ k}\Omega \times 270 \text{ pF} = 8.100\text{E-7s}$

Starting with the largest C2 value of 24 pF (once again, for best noise performance) results in R2 = 33.75 k Ω .

This is within the programmable R2 value of 24.60 k Ω to 834.8 k Ω , and so 24 pF can be used for C2. Picking the next higher programmable value for R2 \rightarrow Set R2 = 43.3 k Ω .

- 6. Then configure the MIN_FREQ field. The sensor minimum frequency is 4.11 MHz, which occurs with the minimum target interaction. Therefore, MIN_FREQ is set to 14, which configures the watchdog for 4.0 MHz.
- Next, set the response time. Setting 6144 will provide the highest resolution R_P measurement with this sensor. With 6144 the sample rate will be at least 2.01 kSPS. To attain highest resolution with a sample rate of >3 kSPS, the response time setting should be 3072.
- 8. All other device settings can be in their default values.

Table 40. LDC1101 Register Settings for RP+L Example Application

FIELD	FIELD SETTING	FIELD VALUE	FIELD VALUE REGISTER		
RPMAX_DIS	disabled	b0		0x36	
RPMAX	12.0 kΩ	b011	RP_SET (0x01)		
RPMIN	1.5 kΩ	b110			
C1	6 pF	b11		0×DE	
R1	33.9 kΩ	b1'1110	TC1 (0x02)	0xDE	
C2	24 pF	b11		0xFE	
R2	43.3 kΩ	b11'1110	TC2 (0x03)	UXFE	

www.ti.com.cn



	-	-	• • • •	
FIELD	FIELD SETTING	FIELD VALUE	REGISTER	REGISTER VALUE
MIN_FREQ	4.0 MHz	b1110		0xE6
RESP_TIME	3072	b110	DIG_CONF (0x04)	UXEO
FUNC_MODE	active	b00	START_CONFIG (0x0B)	0x00

Table 40. LDC1101 Register Settings for RP+L Example Application (continued)

On power-up, the LDC1101 enters Sleep mode, which is a low power mode used to configure the LDC. If the LDC1101 is actively converting, write 0x01 to START_CONFIG (address 0x0B) to stop conversions before writing the settings above.

Once the LDC1101 is configured, the process to retrieve RP+L conversion results is:

- 1. Set the LDC1101 into conversion mode (active mode) by writing 0x00 to START_CONFIG (register 0x0B).
- 2. Poll STATUS.DRDYB (register 0x20:bit6) until it indicates a conversion result is present, or use the INTB signal reporting as described in *DRDY (Data Ready) Reporting on SDO*.
- 3. If the desired measurement is R_P, then read back registers 0x21 and 0x22. The R_P output code is the contents of register 0x21 + 256 × (contents of register 0x22).
- 4. If the desired measurement is L, then read back registers 0x23 and 0x24. The L output code is the contents of register 0x23 + 256 × (contents of register 0x24). Reading both R_P and L is permitted, for a more efficient operation R_P and L registers can be retrieved in a single extended SPI transaction as described in *SPI Programming*.
- 5. Process the conversion results on the MCU and repeat from step 2 if additional conversions are desired. If no additional conversions are required, place the LDC1101 into Sleep mode or Shutdown mode.

9.2.2.2 Device Configuration for LHR Measurement with an Example Sensor

Given a sensor with characteristics as shown in Table 39, the steps to configure the LDC1101 for LHR measurements are:

1. Determine the device sample rate, based on system requirements, using Equation 14. For this example, $f_{CLKIN} = 16$ MHz and a sample rate of 3 kSPS is necessary. The number of cycles of the f_{CLKIN} that closest fit the desired sample rate is determined by:

1/(3 kSPS) = 333.3 µs

subtracting the conversion post-processing time of 55 reference clock cycles (55/16 MHz = 3.437 μ s): 333.3 μ s - 3.437 μ s = 329.9 μ s \rightarrow 16 MHz × 163.2 μ s = 5278.34 \rightarrow 5278.34/16 = 329.9

Programming RCOUNT to 330 (0x014A) results in a sample rate of 2.999 kSPS.

- Next, set the sensor drive. If the sensor was already configured for RP+L measurements with the steps in Device Configuration for R_P+L Measurement with an Example Sensor, then the sensor drive is already configured and no additional steps are necessary.
- 3. If the sensor drive needs to be configured, from *Table 36*, 3 k Ω is the appropriate setting for the sensor R_P range of 6.33 k Ω to 5.61 k Ω .

FIELD	FIELD SETTING	FIELD VALUE	REGISTER	REGISTER VALUE
RPMAX_DIS	disabled	b0		
RPMAX	doesn't matter	b111	RP_SET (0x01)	0x75
RPMIN	1.5 kΩ	b101		
MIN_FREQ	4.0 MHz	b1110		0.457
RESP_TIME	don't care	b111	DIG_CONF (0x04)	0xE7
DCOUNT	5000	220	LHR_RCOUNT_LSB (0x30)	0x4A
RCOUNT	5280	330	LHR_RCOUNT_MSB (0x31)	0x01
FUNC_MODE	active	b00	START_CONFIG (0x0B)	0x00

Table 41. LDC1101 Register Settings for LHR Example Application	Table 41. LDC110	I Register	Settings for	LHR Exampl	e Application
---	------------------	------------	--------------	------------	---------------



Once the LDC1101 is configured, the process to retrieve LHR conversion results is:

- 1. Set the LDC1101 into conversion mode (active mode) by writing 0x00 to START_CONFIG (register 0x0B).
- 2. Poll LHR_STATUS.DRDYB (register 0x3B:bit0) until it indicates a conversion result is present, or use the INTB signal reporting as described in *DRDY (Data Ready) Reporting on SDO.*
- 3. Read back registers 0x38, 0x39, and 0x3A. These registers can be retrieved in a single extended SPI transaction as described in *SPI Programming*.
- 4. Process the conversion results on the MCU and repeat from step 2 if additional conversions are desired. If no additional conversions are required, place the LDC1101 into Sleep mode or Shutdown mode.

Both sets of conversion results can be retrieved when the conversions complete. Note that the RP+L conversions will not complete at the same time as LHR conversions.

9.2.3 Application Curves

The RCOUNT = 0x00FF curve, which corresponds to a sample rate of 3.87 ksps, will measure the target position with a slightly lower resolution than the RCOUNT = 0x014A used in this example. Over the target movement range of 3 mm, which corresponds to the normalized value of 0.3 on the Axial Measurement graph, the target position can be resolved to 4 μ m.

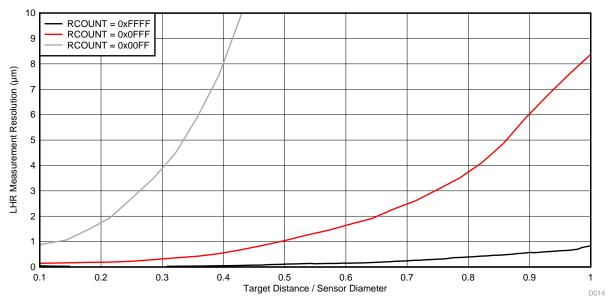


Figure 59. LHR Axial Measurement Resolution vs Normalized Distance for Aluminum Target



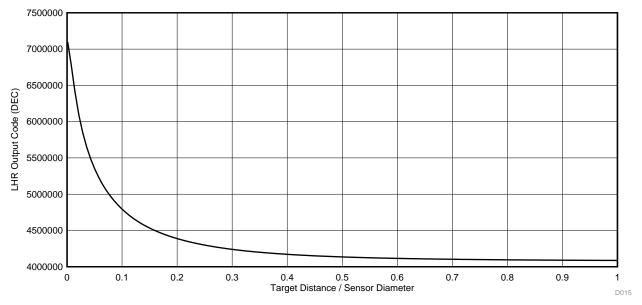


Figure 60. LHR Output Code vs Normalized Distance for Aluminum Target



10 Power Supply Recommendations

A parallel set of 1 μ F and 0.1 μ F capacitors should be used to bypass V_{DD}, although it may be necessary to include a larger capacitor with systems which have a larger amount of supply variation. The smallest value capacitor should be placed as close as possible to the VDD pin. A ground plane is recommended to connect both the ground and the Die Attach Pad (DAP).

 C_{LDO} capacitor should be nonpolarized and have an equivalent series resistance (ESR) less than 1 Ω , with a SRF of at least 24 MHz.

11 Layout

11.1 Layout Guidelines

The LDC1101 requires minimal external components for effective operation. Following good layout techniques - providing good grounding and clean supplies are critical for optimum operation. Due to the small physical size of the LDC1101, use of surface mount 0402 or smaller components can ease routing.

11.1.1 Ground and Power Planes

Ground and power planes are helpful for maintaining a clean supply to the LDC1101. In the layout shown in Figure 61, a top-layer ground fill is also used for improved grounding.

11.1.2 CLKIN Routing

The CLKIN pin routing should maintain consistent impedance; typically this is 50Ω , but can be adjusted based on board geometries. If a parallel termination resistor is used, it should be placed as close as possible to the CLKIN pin. Minimize layer changes and routing through vias for the CLKIN signal. Maintain an uninterrupted ground plane under the trace.

11.1.3 Capacitor Placement

The capacitor C_{LDO} should be placed as close as possible to the CLDO pin.

Place the bypass capacitors as close as possible to the VDD pin, with the smaller valued capacitor placed closer.

11.1.4 Sensor Connections

The sensor capacitor should be as close as possible to the sensor inductor. The INA and INB traces should be routed in parallel and as close as possible to each other to minimize coupling of noise. If cable is to be used, then INA and INB should be a twisted pair or in coaxial cable. The distance between the INA/INB pins and the sensor will affect the maximum possible sensor frequency. For some applications, it may be helpful to place small value capacitor (for example, 10 pF) from INA to ground and INB to ground; these capacitors should be located close to the INA and INB pins.

Refer to Application Note LDC Sensor Design (SNOA930) for additional information on sensor design.



11.2 Layout Example

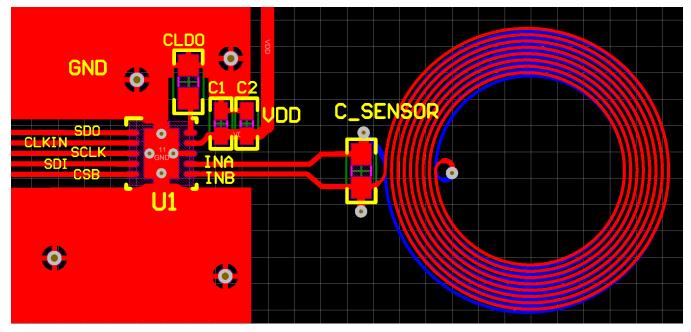


Figure 61. Layout Recommendations

LDC1101 ZHCSDS7A – MAY 2015 – REVISED JUNE 2015

www.ti.com.cn

INSTRUMENTS

Texas

12 器件和文档支持

12.1 器件支持

12.1.1 开发支持

要获取在线 LDC 系统设计工具,请访问德州仪器的 Webench[®] 工具

LDC 计算器工具提供了一系列在 MS Excel[®] 下运行的计算工具,这些工具对于 LDC 的系统开发非常有用。

12.2 文档支持

12.2.1 相关文档

有关 LDC 传感器设计的详细信息,请参见《LDC 传感器设计应用报告》(文献编号: SNOA930)。

有关使用 LDC 进行横向位置感测(其中目标点移动时与传感器保持一定高度的距离,然后测量偏差)的详细信息,请参见《LDC1612/LDC1614 线性位置感测》(文献编号: SNOA931)。 LDC1101 LHR 模式的功能相当于 单通道 LDC1612/LDC1614。

有关温度补偿的信息,请参见《LDC1000 温度补偿》(文献编号: SNAA212)。

12.3 社区资源

The following links connect to TI community resources. Linked contents are provided "AS IS" by the respective contributors. They do not constitute TI specifications and do not necessarily reflect TI's views; see TI's Terms of Use.

TI E2E[™] Online Community *TI's Engineer-to-Engineer (E2E) Community.* Created to foster collaboration among engineers. At e2e.ti.com, you can ask questions, share knowledge, explore ideas and help solve problems with fellow engineers.

Design Support TI's Design Support Quickly find helpful E2E forums along with design support tools and contact information for technical support.

12.4 商标

E2E is a trademark of Texas Instruments. Webench is a registered trademark of Texas Instruments. Excel is a registered trademark of Microsoft Corporation. SPI is a trademark of Motorola. All other trademarks are the property of their respective owners.

12.5 静电放电警告



这些装置包含有限的内置 ESD 保护。存储或装卸时,应将导线一起截短或将装置放置于导电泡棉中,以防止 MOS 门极遭受静电损伤。

12.6 术语表

SLYZ022 — TI 术语表。

这份术语表列出并解释术语、首字母缩略词和定义。

13 机械、封装和可订购信息

以下页中包括机械、封装和可订购信息。 这些信息是针对指定器件可提供的最新数据。 这些数据会在无通知且不 对本文档进行修订的情况下发生改变。 欲获得该数据表的浏览器版本,请查阅左侧的导航栏。



PACKAGING INFORMATION

Orderable part number	Status (1)	Material type (2)	Package Pins	Package qty Carrier	RoHS (3)	Lead finish/ Ball material	MSL rating/ Peak reflow	Op temp (°C)	Part marking (6)
LDC1101DRCR	Active	Production	VSON (DRC) 10	3000 LARGE T&R	Yes	(4) NIPDAU	(5) Level-1-260C-UNLIM	-40 to 125	L1101
LDC1101DRCR.A	Active	Production	VSON (DRC) 10	3000 LARGE T&R	Yes	NIPDAU	Level-1-260C-UNLIM	-40 to 125	L1101
LDC1101DRCT	Obsolete	Production	VSON (DRC) 10	-	-	Call TI	Call TI	-40 to 125	L1101

⁽¹⁾ **Status:** For more details on status, see our product life cycle.

(2) Material type: When designated, preproduction parts are prototypes/experimental devices, and are not yet approved or released for full production. Testing and final process, including without limitation quality assurance, reliability performance testing, and/or process qualification, may not yet be complete, and this item is subject to further changes or possible discontinuation. If available for ordering, purchases will be subject to an additional waiver at checkout, and are intended for early internal evaluation purposes only. These items are sold without warranties of any kind.

⁽³⁾ RoHS values: Yes, No, RoHS Exempt. See the TI RoHS Statement for additional information and value definition.

⁽⁴⁾ Lead finish/Ball material: Parts may have multiple material finish options. Finish options are separated by a vertical ruled line. Lead finish/Ball material values may wrap to two lines if the finish value exceeds the maximum column width.

⁽⁵⁾ MSL rating/Peak reflow: The moisture sensitivity level ratings and peak solder (reflow) temperatures. In the event that a part has multiple moisture sensitivity ratings, only the lowest level per JEDEC standards is shown. Refer to the shipping label for the actual reflow temperature that will be used to mount the part to the printed circuit board.

⁽⁶⁾ Part marking: There may be an additional marking, which relates to the logo, the lot trace code information, or the environmental category of the part.

Multiple part markings will be inside parentheses. Only one part marking contained in parentheses and separated by a "~" will appear on a part. If a line is indented then it is a continuation of the previous line and the two combined represent the entire part marking for that device.


Important Information and Disclaimer: The information provided on this page represents TI's knowledge and belief as of the date that it is provided. TI bases its knowledge and belief on information provided by third parties, and makes no representation or warranty as to the accuracy of such information. Efforts are underway to better integrate information from third parties. TI has taken and continues to take reasonable steps to provide representative and accurate information but may not have conducted destructive testing or chemical analysis on incoming materials and chemicals. TI and TI suppliers consider certain information to be proprietary, and thus CAS numbers and other limited information may not be available for release.


In no event shall TI's liability arising out of such information exceed the total purchase price of the TI part(s) at issue in this document sold by TI to Customer on an annual basis.



www.ti.com

TAPE AND REEL INFORMATION

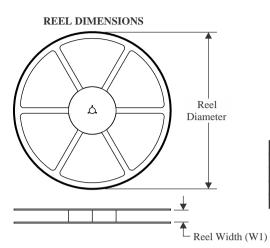

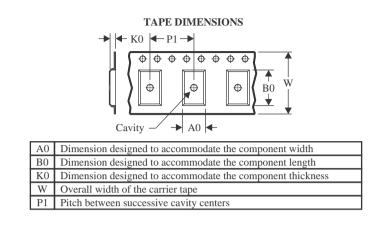

QUADRANT ASSIGNMENTS FOR PIN 1 ORIENTATION IN TAPE



*All dimensions	are nominal
-----------------	-------------

Device	Package Type	Package Drawing		SPQ	Reel Diameter (mm)	Reel Width W1 (mm)	A0 (mm)	B0 (mm)	K0 (mm)	P1 (mm)	W (mm)	Pin1 Quadrant
LDC1101DRCR	VSON	DRC	10	3000	330.0	12.4	3.3	3.3	1.1	8.0	12.0	Q2



www.ti.com

PACKAGE MATERIALS INFORMATION

20-Feb-2024



*All dimensions are nominal

Device	Package Type	Package Drawing	Pins	SPQ	Length (mm)	Width (mm)	Height (mm)
LDC1101DRCR	VSON	DRC	10	3000	346.0	346.0	33.0

DRC 10

3 x 3, 0.5 mm pitch

GENERIC PACKAGE VIEW

VSON - 1 mm max height

PLASTIC SMALL OUTLINE - NO LEAD

This image is a representation of the package family, actual package may vary. Refer to the product data sheet for package details.





重要通知和免责声明

TI"按原样"提供技术和可靠性数据(包括数据表)、设计资源(包括参考设计)、应用或其他设计建议、网络工具、安全信息和其他资源, 不保证没有瑕疵且不做出任何明示或暗示的担保,包括但不限于对适销性、某特定用途方面的适用性或不侵犯任何第三方知识产权的暗示担 保。

这些资源可供使用 TI 产品进行设计的熟练开发人员使用。您将自行承担以下全部责任:(1) 针对您的应用选择合适的 TI 产品,(2) 设计、验 证并测试您的应用,(3) 确保您的应用满足相应标准以及任何其他功能安全、信息安全、监管或其他要求。

这些资源如有变更,恕不另行通知。TI 授权您仅可将这些资源用于研发本资源所述的 TI 产品的相关应用。 严禁以其他方式对这些资源进行 复制或展示。您无权使用任何其他 TI 知识产权或任何第三方知识产权。您应全额赔偿因在这些资源的使用中对 TI 及其代表造成的任何索 赔、损害、成本、损失和债务,TI 对此概不负责。

TI 提供的产品受 TI 的销售条款或 ti.com 上其他适用条款/TI 产品随附的其他适用条款的约束。TI 提供这些资源并不会扩展或以其他方式更改 TI 针对 TI 产品发布的适用的担保或担保免责声明。

TI 反对并拒绝您可能提出的任何其他或不同的条款。

邮寄地址:Texas Instruments, Post Office Box 655303, Dallas, Texas 75265 版权所有 © 2025,德州仪器 (TI) 公司